

Report ID:	24,879,087	Version:	2
Created:	21 Aug 2026		


Make:	Mazda	Model:	Bt-50
Body Style:	Utility	Year:	2018
Rego No.:	LSR123	Rego Expiry:	04 Nov 2026
WoF Expiry:	28 Aug 2027	Odometer:	314,611 Kms
Good No.:	24879087	VIN:	MM0UR0YG100850485
Next Service:	320,700km's	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

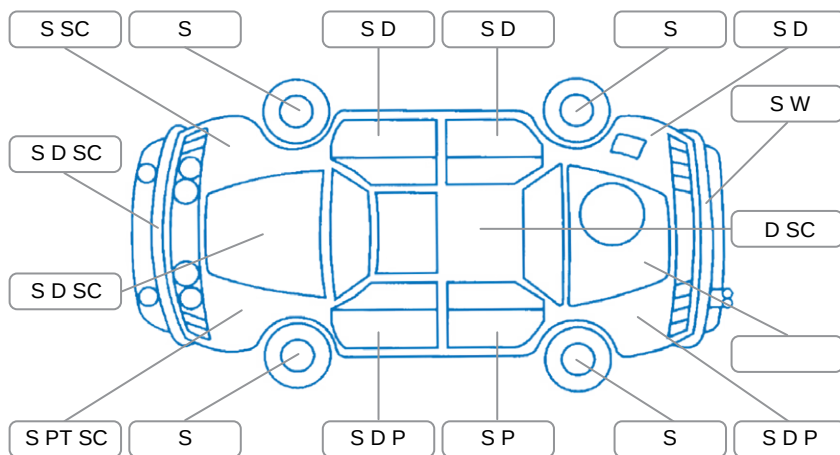

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Cracks in right rear taillight lens, water inside lens. Missing left rear mud flap. Dents along left & right side sills. Dent in left side of front bumper has deformed plastic, bumper out of shape. Inside edge on right front tyre is worn, tyre needs replaced.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Plastic centre caps missing off right front & right rear wheels.

Interior Comments

Seats:	Average
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Rear lock on rear canopy door is not locking. Right front door frame seals are torn & damaged. Right rear door frame seal is torn & damaged. Paint overspray on left front interior door panel. Hole in fabric on base pad of driver's seat. Top of steering wheel is worn. Gearshift boot needs refitted.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Jason Young
Published by:	Glen Charlton
Inspection Date:	06 Aug 2026

OK Requires Attention N/A

Engine

Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		

Transmission

Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		

Brakes

Performance	✓		
Hand brake	✓		

Tyres (lowest observed tread depth of tyres)

Left front	4.5 mm
Right front	1.0 mm
Left rear	6.0 mm
Right rear	6.0 mm
Spare	Yes

Suspension

Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		

Air Conditioning / Heater

Operation	✓		
-----------	---	--	--

Electrical / Accessories

Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	3		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____