


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2020
Rego No.:	MYP664	Rego Expiry:	02 Mar 2026
WoF Expiry:	23 Oct 2026	Odometer:	167,601 Kms
Good No.:	24985407	VIN:	MMAJLKL10LH011733
Next Service:	3/6/26 or 175000km	Service History:	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key

S = Scratch      R = Rust      C = Crack      \* = Decals      W = Significant scuffs  
D = Dent      PT = Paint defect      P = Pin dent      SC = Stone Chips

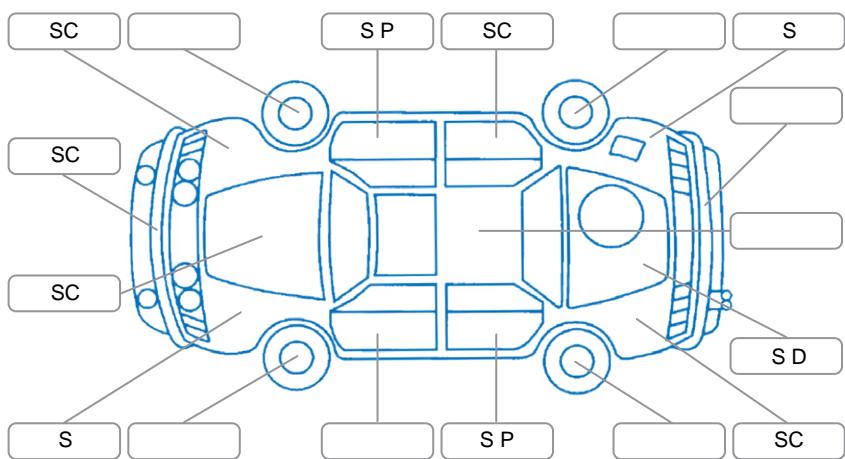

Note: some defects and blemishes may not be displayed in the diagram

## Body Inspection Comments

Stone chips in windscreen.  
Missing LH front bumper panel

Conditions During Body Inspection	Dry
-----------------------------------	-----

#### Under Carriage and Under Bonnet Inspection Comments

### Surface corrosion underneath vehicle.

## Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

## General Comments

---

Vehicle drove well.

DPF system service required message on dash screen.

Road Conditions During Test Drive	Dry				
Engine Timing Mechanism	Timing Chain				
Evidence of Cam Belt Replacement	<input type="checkbox"/>	Yes	<input type="checkbox"/>	No	Kms
Inspected by:	Aaron Johnson				
Published by:	Aaron Johnson				
Inspection Date:	30 Dec 2025				

I have read and understood  
this condition guide:

**NAME**

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front		10 mm	
Right front		2.6 mm	
Left rear		10 mm	
Right rear		10 mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		