


<b>Make:</b>	Volkswagen	<b>Model:</b>	Tiguan	<b>Body Style:</b>	Wagon
<b>Year:</b>	2009	<b>Registration:</b>	KSH197	<b>Reg Expiry:</b>	20 Dec 2023
<b>WoF Expiry:</b>	16 Nov 2024	<b>Odometer:</b>	112,335 Kms	<b>Good No:</b>	25138917
<b>VIN:</b>	WVGZZZ5NZ9W0918C	<b>Next Service:</b>	no service history	<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

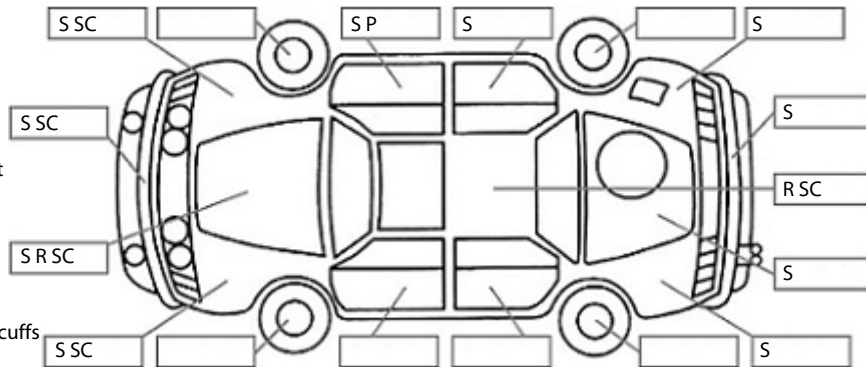

## Body Inspection Comments

Front bumper loose in top lh corner.

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Oil leaks. Battery failed test. Oil level low. Rear brakes wearing poor recommend further inspection. Underbody has had rust treatment possibly rust under this. Major oil leaks. Belly pan missing fixtures

## Interior Comments

Seats	Good
Carpets	Good
Panels	Average . damage to Lhf door card
Dashboard	good. some air vents broken

## General Comments

Interior light panel loose. Center air vents above radio screen broken. Engine light on. Epc light on. Vehicle entered limp mod during test drive. Transmission shift is rough. Vehicle requires Minimum 96 octane fuel. Squeaking noise while driving from wheels

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance		✓	
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation		✓	
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5.0	mm	
Right front	5.0	mm	
Left rear	5.0	mm	
Right rear	5.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Reuben Harvey

Date: 28 Nov 2023

I have read and understood this condition guide.

Name: .....

Signature: .....