


<b>Make:</b>	Holden	<b>Model:</b>	Commodore	<b>Body Style:</b>	Sedan
<b>Year:</b>	2008	<b>Registration:</b>	HFH185	<b>Reg Expiry:</b>	21 Apr 2024
<b>WoF Expiry:</b>	31 Jul 2024	<b>Odometer:</b>	293,223 Kms	<b>Good No:</b>	25174001
<b>VIN:</b>	6G1EK5779L161651	<b>Next Service:</b>	290,000 Kms	<b>Service History:</b>	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

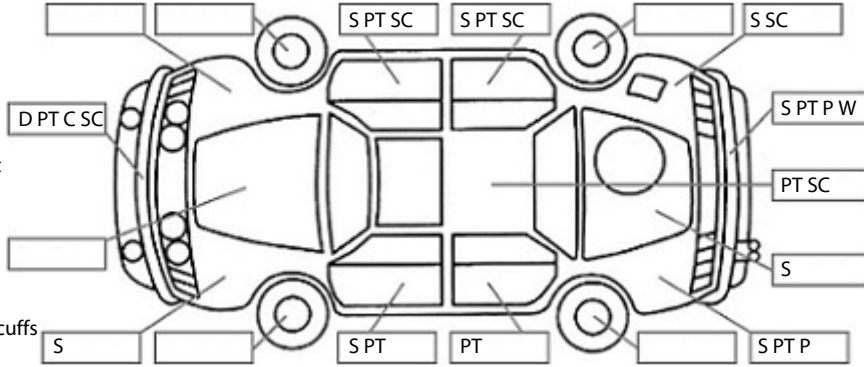

**Body Inspection Comments**

Stone chip in front windscreen  
Hood lining held up with staples  
Front bumper slightly hanging low

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Engine oil seep and weep  
Rust on underside of vehicle

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Good

**General Comments**

Partial service history  
Drivers window doesn't work  
Check engine warning light on  
Plastic trim on right side of drivers seat is loose  
Unknown knocking noise from rear when going over bumps  
Engine and transmission performance were average on test drive

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5.1	mm	
Right front	5.3	mm	
Left rear	5.7	mm	
Right rear	5.9	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR		✓	
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Hoani Saunders

Date: 14 Dec 2023

I have read and understood this condition guide. Name: ..... Signature: .....