


<b>Make:</b>	Audi	<b>Model:</b>	A4	<b>Body Style:</b>	Wagon
<b>Year:</b>	2009	<b>Registration:</b>	JBH685	<b>Reg Expiry:</b>	12 Feb 2024
<b>WoF Expiry:</b>	16 Feb 2024	<b>Odometer:</b>	165,521 Kms	<b>Good No:</b>	25556672
<b>VIN:</b>	WAUZZZ8K6AA00905	<b>Next Service:</b>	158000 kms	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

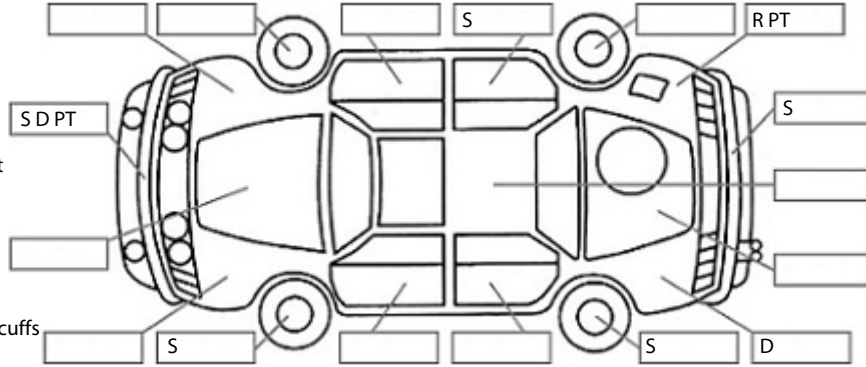

**Body Inspection Comments**

Headliner falling.  
RL guard liner Damaged and rubbing on wheel.  
Front bumper grille missing trim.

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

4WD  
Valve cover gasket oil stains. Engine oil stains.  
RR bumpstop perished.  
Rear differential oil stains.  
Underbody covers damaged.

**Interior Comments**

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

**General Comments**

Suspension creaks over bumps.  
Oil level low, headlight range warning messages on dash.  
Front wiper blades need replacing.  
Engine start/stop button damaged.  
Right inner taillight brake light has some leds not working.  
Battery tested under 12V. (Recharge)

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level		✓	
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	8	mm	
Right front	8	mm	
Left rear	8	mm	
Right rear	8	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Eleoit Kumar

Date: 07 Feb 2024

I have read and understood this condition guide. Name: ..... Signature: .....