


<b>Make:</b>	Ford	<b>Model:</b>	Fiesta	<b>Body Style:</b>	Hatchback
<b>Year:</b>	2011	<b>Registration:</b>	FWQ403	<b>Reg Expiry:</b>	13 May 2024
<b>WoF Expiry:</b>	23 Sep 2024	<b>Odometer:</b>	175,624 Kms	<b>Good No:</b>	25597508
<b>VIN:</b>	MNBJXXARJJAR21669	<b>Next Service:</b>	171734km	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

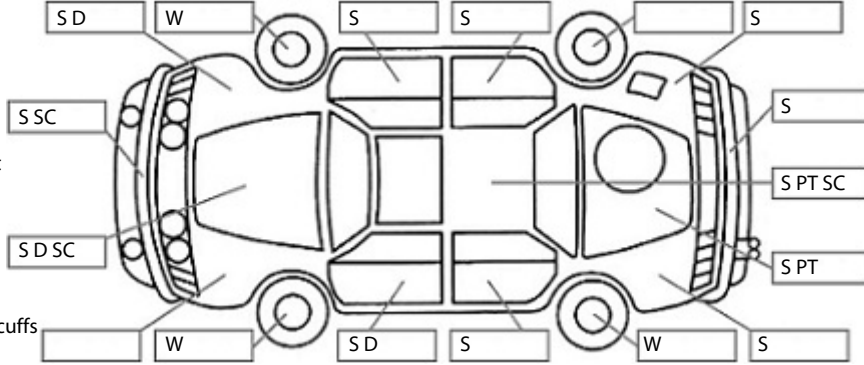

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Missing tyre repair kit. Left sun visor broken. Burn hole R/R seat. Middle seat belt retracting slow. Front badge damaged. Rear wiper blade worn. Interior roof light damaged. L/F seat side trim not secure.

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

Front wheel drive.  
L/F tyre sidewall damaged. Oil stain around L/F axle seal.  
Oil leak around oil filter. Front tyres edge quicker wear. Tyres perishing.  
Drive belt cracks.

**Interior Comments**

Seats	Average
Carpets	Good
Panels	Average
Dashboard	Good

**General Comments**

Indicators not turning off after turn. Knocking/creaking noises in steering.  
Number plate light not working.  
Fault codes U0420:00-60/U0423:00-60/U3003:16-60

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	4	mm	
Right front	4.5	mm	
Left rear	6	mm	
Right rear	6	mm	
Spare	N/A		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators		✓	
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Henry Manders

Date: 27 Feb 2024

I have read and understood this condition guide.

Name: .....

Signature: .....