


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Holden | Model: | Cruze | Body Style: | Hatchback |
| Year: | 2012 | Registration: | GLA483 | Reg Expiry: | 14 May 2024 |
| WoF Expiry: | 14 Jul 2024 | Odometer: | 147,454 Kms | Good No: | 25604750 |
| VIN: | 6G1PD6EY7CL648664 | Next Service: | | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

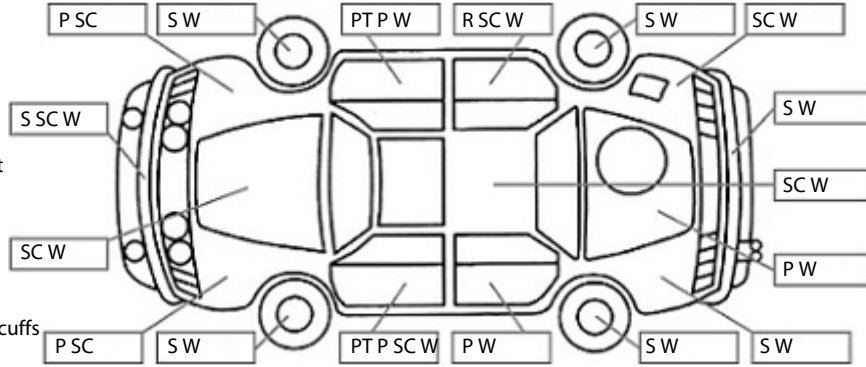

Note: some defects & blemishes may not be displayed in the diagram

Body Inspection Comments

LF tyre looks flat
Chips front screen
Scuffing front bumper lip
Paint defect/fade both sides wing mirror scalp & base
Rust along bottom edge interior RR door

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Oil leak under engine
Clunking noise in front suspension, possible top strut mounts

Interior Comments

| | |
|-----------|-------------------|
| Seats | tear RF seat base |
| Carpets | Average |
| Panels | Average |
| Dashboard | Good |

General Comments

Suspension noise front
Coolant reservoir above manufacturers maximum specification, over filled

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 5.2 | mm | |
| Right front | 5.2 | mm | |
| Left rear | 6.3 | mm | |
| Right rear | 6.5 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Mike Greenfield

Date: 28 Feb 2024

I have read and understood this condition guide. Name: Signature: