


<b>Make:</b>	Mercedes-Benz	<b>Model:</b>	A-Class	<b>Body Style:</b>	Hatchback
<b>Year:</b>	2005	<b>Registration:</b>	DMD655	<b>Reg Expiry:</b>	21 Nov 2024
<b>WoF Expiry:</b>	25 Jan 2025	<b>Odometer:</b>	98,002 Kms	<b>Good No:</b>	25617515
<b>VIN:</b>	WDD1690322J119547	<b>Next Service:</b>		<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

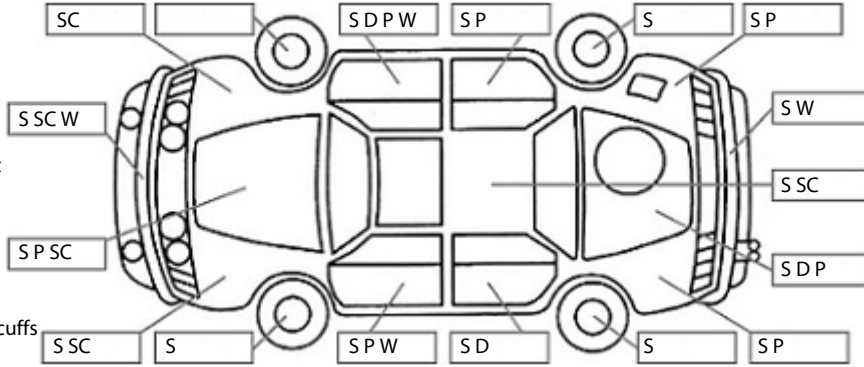

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Rear tailgate window has fine scratches in it from wiper blade. Worn right front tyre, needs replaced.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Right front tyre is scuffing real bad when turning hard left, has damaged the tyre (worn on inside & outside edges of tyre. Needs a wheel alignment.

**Interior Comments**

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

**General Comments**

Engine service is overdue, is coming up on dash display. Front windscreen washers are not working. Both rear central locking motors are noisy, but still work.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	3.4	mm	
Right front	1.5	mm	
Left rear	4.4	mm	
Right rear	5.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking		✓	
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 05 Mar 2024

I have read and understood this condition guide.

Name: .....

Signature: .....