


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Holden | Model: | Commodore | Body Style: | Wagon |
| Year: | 2010 | Registration: | FMP553 | Reg Expiry: | 19 Aug 2024 |
| WoF Expiry: | 23 Dec 2024 | Odometer: | 249,795 Kms | Good No: | 25650042 |
| VIN: | 6G1EP8EY3AL439803 | Next Service: | 260,000 | Service History: | Yes |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

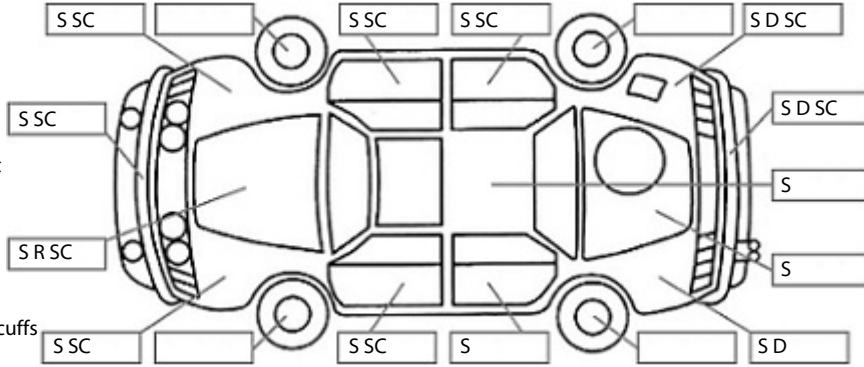

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Pontiac front fitted. Head lining falling out. Different size wheels front to rear. Rear are 275/30/20 and front are 245/35/20. Large bullseye upper lhs centre

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

. Runs on 91 octane.

Interior Comments

| | |
|-----------|-----------------------------|
| Seats | drivers side panels cracked |
| Carpets | Average |
| Panels | scuffs scratches marks |
| Dashboard | scratches |

General Comments

Air conditioning and heating work fine at inspection time. Arm rest in centre broken. Coolant bottle dipstick missing

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 4.0 | mm | |
| Right front | 5.0 | mm | |
| Left rear | 6.0 | mm | |
| Right rear | 4.0 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

Inspected by: Gary Adams

Date: 21 Mar 2024

I have read and understood this condition guide.

Name:

Signature: