


Make:	Subaru	Model:	Legacy	Body Style:	Sedan
Year:	2007	Registration:	KMJ10	Reg Expiry:	28 Sep 2024
WoF Expiry:	29 Jul 2024	Odometer:	208,596 Kms	Good No:	25697307
VIN:	7AT0GF0BX17074251	Next Service:		Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

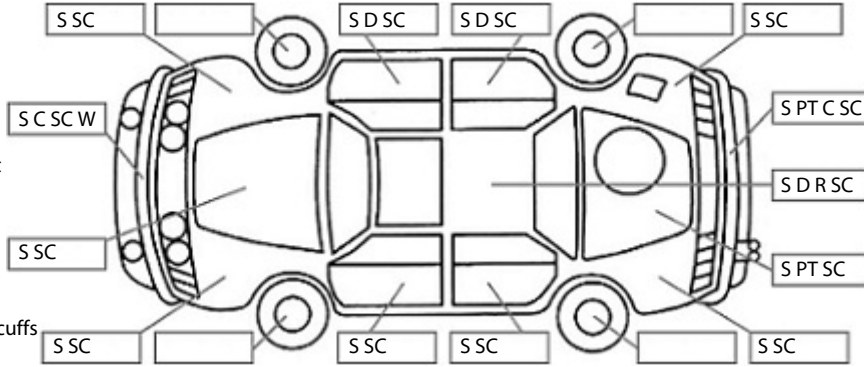

Body Inspection Comments

Water in spare wheel well. Headlights are faded. Both bumper's poor fit

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Brake fluid close to min. Pwr steer fluid very low. Squealing on full lock. Requires serpentine belt. oil leaks. Both inner cv boots split and leaking. Differential leak tested battery and failed. Runs on 95/98 octane fuel. Vehicle has belly pans, will need a groom
Has water leak from top hose or Radiator top tank

Interior Comments

Seats	marks, holes drivers side
Carpets	hole drivers footwell
Panels	scuffs scratches marks dimples holes
Dashboard	scratches

General Comments

Air conditioning and heating work fine at inspection time. Lf window n/w from panel but ok on door. Lr window n/w at all. One remote n/w correct. Rf park light n/w

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	5.0	mm	
Right front	5.0	mm	
Left rear	5.0	mm	
Right rear	5.0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL		✓	
Window winder FR	✓		
Window winder RL		✓	
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Gary Adams

Date: 16 Apr 2024

I have read and understood this condition guide.

Name:

Signature: