

Report ID:	25,921,506	Version:	1
Created:	15 Apr 2026		


Make:	Mazda	Model:	Atenza
Body Style:	Sedan	Year:	2008
Rego No.:	JGB494	Rego Expiry:	24 Jul 2026
WoF Expiry:	07 Apr 2027	Odometer:	232,767 Kms
Good No.:	25921506	VIN:	7AT0C139X15101184
Next Service:	242600	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

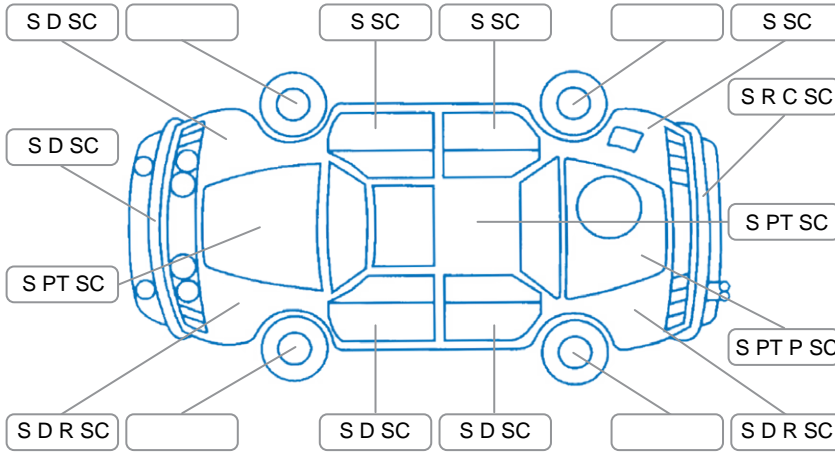

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

- Small crack with legs on windscreen
- Minor stonechips on windscreen
- Water in boot
- Rust in boot

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

- Front wheel drive
- Underbody cover damaged
- Grease around CV boot /possible leak

Interior Comments

Seats:	Good
Carpets:	rip on drivers floor/ average
Panels:	Good
Dashboard:	sticky dash/ average

General Comments

- Drivers window not working
- Push to start button damaged
- Missing drivers floor mat

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms

Inspected by:	Cameron Senior-Arnold
Published by:	Cameron Senior-Arnold
Inspection Date:	15 Apr 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.1 mm
Right front			5.2 mm
Left rear			3.6 mm
Right rear			4.1 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR		✓	
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____