


# **Basic Condition Guide**

•	Report ID:	25,962,443	Version:	2
	Created:	18 Dec 2025		

Make:	Toyota	Model:	Hilux		
Body Style:	Utility	Year:	2015		
Rego No.:	JLC35	Rego Expiry:	15 Jan 2026		
WoF Expiry:	14 Jan 2026	Odometer:	207,719 Kms		
Good No.:	25962443	VIN:	MR0HZ22G203520022		
Next Service:	219,500 Kms	Service History:	No		
Note: This report is not a warranty					
This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.					

Key W = Significant scuffs S = ScratchR = RustC = Crack\* = Decals D = DentPT = Paint defect P = Pin dentSC = Stone Chips

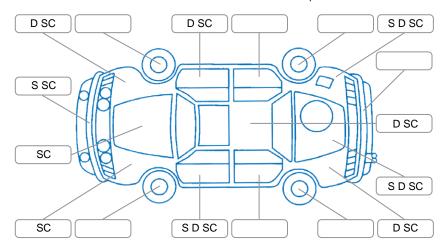

Note: some defects and blemishes may not be displayed in the diagram

## **Body Inspection Comments**

Both running boards are dented. Both front sill step plates are worn. RH taillight cracked and has moisture inside. Canopy window tints are scratched. RH canopy side window struts weak.

No key for roof racks.

Conditions During Body Inspection

## **Under Carriage and Under Bonnet Inspection Comments**

Bash plate dented.

Interior Comments			
Seats:	Average, hole on side of drivers seat base.		
Carpets:	pets: Average		
Panels: Average, holes drilled in centre console.			
Dashboard: Average, steering wheel worn.			
General Comments			

Continuous beeping in cabin when ignition on. Loose aftermarket wiring in passenger footwell.

Radio screen delaminating.

Road Conditions During Test Drive		Dry		
Engine Timing Mechanism		Cambelt		
Evidence of Cam Belt Replacement		Yes	<b>V</b> No	Kms
Inspected by:	Troy Smith			
Published by:	Troy Smith			
Inspection Date:	18 Dec 2025			

I have read and unders	itood	
this condition guide:	NAME	

	ОК	Requires Attention	N/A
Engine	OK	Attention	IN/A
Oil level	/		1
Smoke & fumes	· /		
Engine performance			
Noise			
Coolant condition			
Cooling performance	\( \sigma \)		
Radiator / Hoses (visual)	<b>/</b>		
Transmission			l
Operation	<b>/</b>		
Noise	/		
Clutch	V V		
CV joints	<b>/</b>		
Wheel bearings	<b>/</b>		
Brakes			
Performance	~		
Hand brake	/		
Tyres (lowest observed tread d	epth of	tyres)	
Left front		3	3.0 mm
Right front		3	3.5 mm
Left rear		8	3.0 mm
Right rear		8	3.0 mm
Spare	Yes		
Suspension			
Suspension performance	/		
Steering performance	/		
Shock absorbers	/		
Air Conditioning / Heater			
Operation	<b>✓</b>		
Electrical / Accessories			
Head lights	/		
Tail lights	<b>/</b>		
Indicators	<b>✓</b>		
Dashboard warning lights	\( \sigma \)		
Wipers (front & rear)			
Window winder FL	•		
Window winder FR	<b>/</b>		
Window winder RL			~
Window winder RR			~
Rear view mirrors	<b>✓</b>		
Radio (basic test only)	<b>/</b>		
CD (basic test only)		<b>/</b>	
Number of keys	2	r	
Central locking	/		
Remote locking	<b>/</b>		
Sat. nav. (basic test only)			<b>'</b>
Reversing camera			

SIGNATURE			