


Report ID:	25,998,241	Version:	2
Created:	11 Feb 2026		

Make:	Holden	Model:	Colorado
Body Style:	Utility	Year:	2013
Rego No.:	HBG492	Rego Expiry:	02 Jan 2026
WoF Expiry:	21 Aug 2025	Odometer:	288,410 Kms
Good No.:	25998241	VIN:	MMU148MH0DH695934
Next Service:	254,000 kms	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

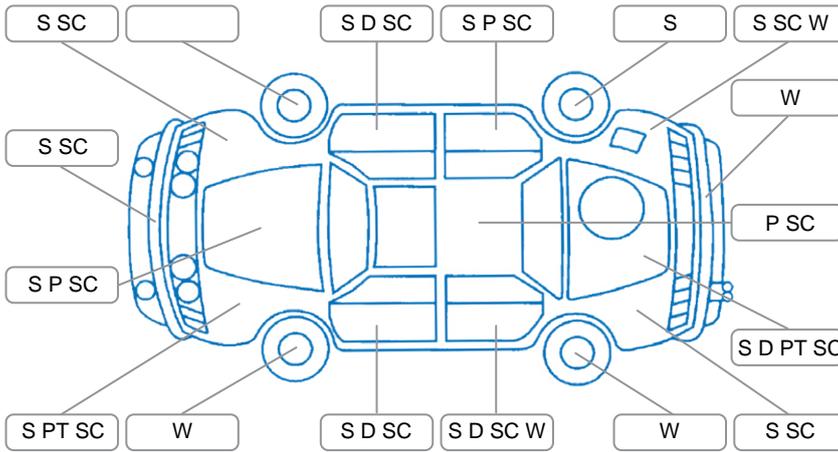

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

LF, RF and LR wheel flares cracked. Left sill bent. No aerial
 Right tail lights scuffed, chips in windscreen
 Dents and scratches tonneau cover

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Right rear tyre flat on arrival, Service esp warning message
 Left front window not working from master switch
 heavy clutch, holes interior right A pillar trim
 Unable to get into 4WD and service 4WD message displayed

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Cambelt	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input checked="" type="checkbox"/> No
Inspected by:	Dean Sinclair	
Published by:	Kate Gibson	
Inspection Date:	11 Feb 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch		✓	
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance		✓	
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			7.5 mm
Right front			7.5 mm
Left rear			7.0 mm
Right rear			7.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL		✓	
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____