


Report ID:	25,998,890	Version:	2
Created:	21 May 2026		

Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2020
Rego No.:	NAQ939	Rego Expiry:	17 Nov 2026
WoF Expiry:	24 Nov 2026	Odometer:	215,872 Kms
Good No.:	25998890	VIN:	MMAJLKK10MH000519
Next Service:	226,000 kms	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

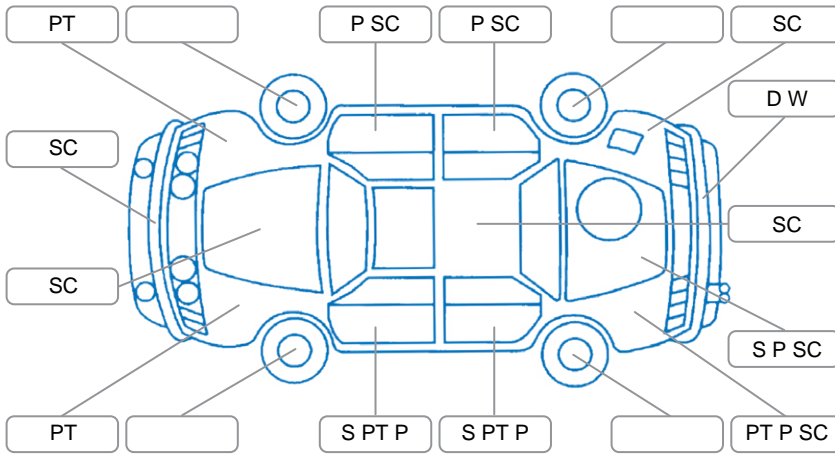

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Right sill running board cap cracked, holes in canopy, chips right A pillar
 Left sill running board cap cracked, canopy door glass missing
 Chips in windscreen, right tail light cracked, chips and dust right B pillar
 Left and right step plates worn, chips and minor dents right cab corner

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats: right front seat base torn
 Carpets: Good
 Panels: Average
 Dashboard: Good

General Comments

Holes and scratches in centre console , chips left A pillar
 Minor dents and scratches left B pillar,
 Minor dents left inner wheel arch

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Dean Sinclair		
Published by:	Carl Williams		
Inspection Date:	06 May 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.0 mm
Right front			5.5 mm
Left rear			4.0 mm
Right rear			3.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____