

Basic Vehicle Condition Guide


Report ID: 26,044,135

Version:

Make: Model: Ford Falcon **Body Style:** Sedan Year: 2007 Registration: JWE528 **Reg Expiry:** 26 Mar 2025 **WoF Expiry: Odometer:** 15 Feb 2025 156,828 Kms **Good No:** 26044135 VIN: 6FPAAAJGSW6R40028 Next Service: 156,000kms Service History:

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

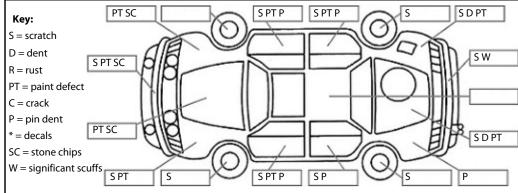

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Paintwork faded on bonnet, roof & boot panel. Clear coat peeling off top of right rear door & right & left side wing mirrors. Window tint has wrinkled up on left front door window & rear window. Rust developing around seams on inside of boot, by both boot hinges. Right front spot light lens, cracked

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Coolant system is low & radiator/coolant system needs a flush. Gas struts on bonnet need replaced, bonnet will not stay up. Minor oil leak around front crack seal, bottom of timing chain cover. Oil weeping from between engine & gearbox. Rear diff is weeping oil. Vehicle jack & tools are missing.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Good

General Comments

Interior roof lining sagging, has just about come completely off roof panel. Master switch on drivers door for electric windows will only work drivers door window. Right rear door electric window is not working. Hole in fabric on back rest of drivers seat & base trim plastics are cracked.

Road Conditions During Test Drive: Dry

Timing Chain

Evidence of Cam Belt Replacement:

Engine Timing Mechanism:

Not Applicable

Kms:

Jason Young Inspected by:

Engine Oil level Smoke & fumes Performance Noise Cooling System Coolant condition Performance Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear 3.8 n	N/A
Oil level Smoke & fumes Performance Noise Cooling System Coolant condition Performance Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Smoke & fumes Performance Noise Cooling System Coolant condition Performance Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front A.2 nn Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Noise Cooling System Coolant condition Performance Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Noise Cooling System Coolant condition Performance Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Noise Cooling System Coolant condition Performance Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Coolant condition Performance Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Performance Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Left rear Right front Left rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Radiator / Hoses (visual) Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Transmission Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front A.2 n Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Operation Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Noise Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Clutch CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
CV joints Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	/
Wheel bearings Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	-
Brakes Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front A.2 n Right front Left rear A.8 n Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Performance Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Hand Brake Tyres (lowest observed tread depth of tyres) Left front Right front Left rear 3.8 Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Tyres (lowest observed tread depth of tyres) Left front 4.2 n Right front 4.6 n Left rear 3.8 n Right rear 3.5 n Spare N/A Suspension Suspension performance ✓ Steering performance ✓ Shock absorbers ✓ Air Conditioning / Heater Operation ✓ Electrical / Accessories Head lights ✓ Tail lights	
Left front 4.2 m Right front 4.6 m Left rear 3.8 m Right rear 3.5 m Spare N/A Suspension Suspension performance ✓ Steering performance ✓ Shock absorbers ✓ Air Conditioning / Heater Operation ✓ Electrical / Accessories Head lights ✓ I ail lights	
Right front 4.6 m Left rear 3.8 m Right rear 3.5 m Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Left rear 3.8 n Right rear 3.5 n Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	ım
Right rear Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	ım
Spare N/A Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	ım
Suspension Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	ım
Suspension performance Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Steering performance Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Shock absorbers Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Air Conditioning / Heater Operation Electrical / Accessories Head lights Tail lights	
Operation Electrical / Accessories Head lights Tail lights	
Electrical / Accessories Head lights Tail lights	
Head lights Tail lights	
Tail lights 🗸	
Indicators Dashboard warning lights	
Dashboard warning lights 🗸	
Window winder FL 🗸	
Window winder FR	
Window winder RL	
Window winder RR	
Rear view mirrors	
Radio (basic test only)	
CD (basic test only)	
Number of keys 2	
Central locking	
Remote locking	
Sat. Nav. (basic test only)	
Reversing camera	

28 Apr 2025

Date:

I have read and understood this condition guide. Signature: Name: