


Make:	Holden	Model:	Captiva 7	Body Style:	SUV
Year:	2016	Registration:	KFT658	Reg Expiry:	11 Dec 2025
WoF Expiry:	13 Dec 2025	Odometer:	149,205 Kms	Good No:	26044306
VIN:	KL3CD2659GB538161	Next Service:	?	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

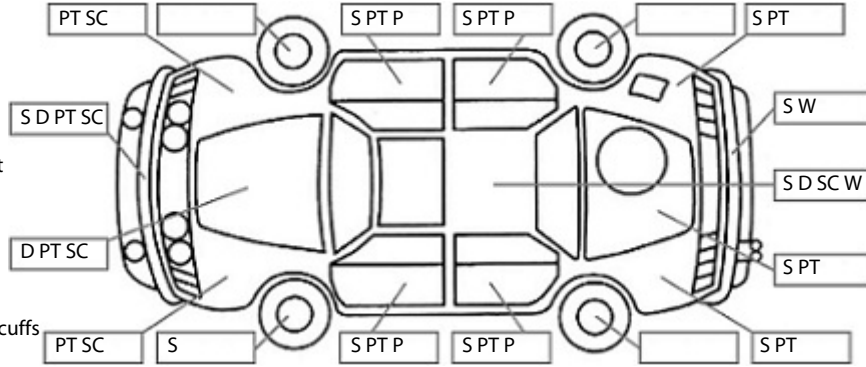

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Holes in left & right side corners of front bumper. Two R/T aerial bases & rubber grommet fitted to roof panel. Plastic trim missing off left side door, by wing mirror. Dents across centre of roof panel. Bolt holes in left front floor area.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Front suspension is a bit noisy when turning steering wheel.

Interior Comments

Seats	Good
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Horn is not working. A/C is not getting cold, needs attention. Holes in middle & right side of dashboard. Screw holes in top & left side of centre console. Both front radio speakers are not working. Both rear seats are missing, vehicle only has five seats. Two key remotes are not working.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	6.4	mm	
Right front	6.2	mm	
Left rear	5.3	mm	
Right rear	6.0	mm	
Spare	Yes		
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	3		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 29 Apr 2025

I have read and understood this condition guide.

Name:

Signature: