


<b>Make:</b>	Hyundai	<b>Model:</b>	Santa FE	<b>Body Style:</b>	SUV
<b>Year:</b>	2021	<b>Registration:</b>	NJQ836	<b>Reg Expiry:</b>	24 Jun 2025
<b>WoF Expiry:</b>	26 Mar 2026	<b>Odometer:</b>	200,107 Kms	<b>Good No:</b>	26044560
<b>VIN:</b>	KMH5281HWMU367683	<b>Next Service:</b>	200,000kms	<b>Service History:</b>	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

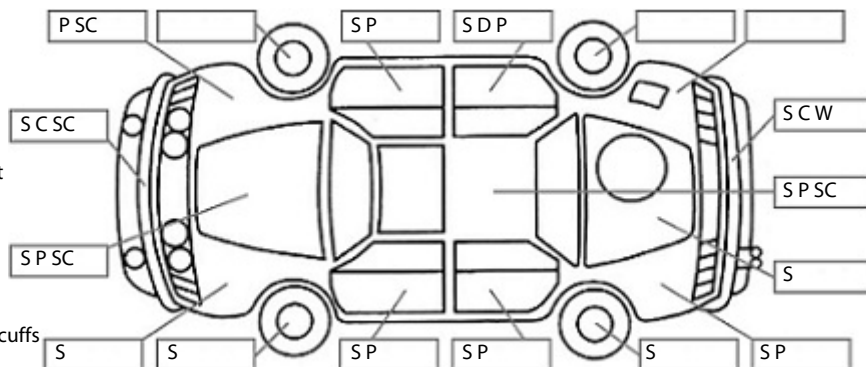

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Large cracks in front & rear bumpers. Dents & scratches on left rear inner wheel arch, inside of left rear door frame. Three small stone cracks in windscreen & two poor stone chip repairs, one of poor repairs are in right side drivers viewing area of screen.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Oil weeping bottom of gearbox.

**Interior Comments**

Seats	Good
Carpets	Average
Panels	Average
Dashboard	Good

**General Comments**

Engine service is overdue. Boot carpet is stained & dirty. Wear around top area of steering wheel cover.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	2.0	mm	
Right front	1.4	mm	
Left rear	7.0	mm	
Right rear	7.0	mm	
Spare	N/A		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 06 May 2025

I have read and understood this condition guide.

Name: .....

Signature: .....