

## **Basic Vehicle Condition Guide**

Report ID: 26,045,102


Version: 3

Created: 26 May 2025

Make: Model: Mazda Axela **Body Style:** Hatchback Year: 2005 Registration: KYY719 **Reg Expiry:** 13 Oct 2024 **WoF Expiry: Odometer:** 15 Jan 2026 157,500 Kms **Good No:** 26045102 VIN: 7AT0C13JX17201998 Next Service: ? Service History:

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

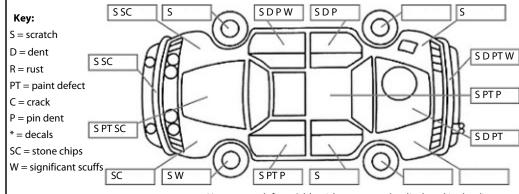

## **Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Paintwork clear coat is worn on bonnet & roof panel. Left side wing mirror cover is a different colour to rest of door panel. Large dent in rear tailgate. Right side wing mirror cover is cracked & has a large hole in it.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments** 

<u>Interior Comments</u>			
Seats	Average		
Carpets	Average		
Panels	Average		
Dashboard	Average		

## **General Comments**

Interior panel missing off tailgate. A/C is not getting cold. Right front indicator is not working. Interior roof light is not working when switched to door. Radio controls on steering wheel are not working, has a aftermarket radio fitted.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Jason Young Date: 26 May 2025

	Pass	Fail	N/A	
Engine				
Oil level	>			
Smoke & fumes	V V			
Performance	~			
Noise	~			
Cooling System				
Coolant condition	~			
Performance	~			
Radiator / Hoses (visual)	~			
Transmission				
Operation	<b>'</b>			
Noise	<b>'</b>			
Clutch			~	
CV joints	<b>'</b>			
Wheel bearings	~			
Brakes				
Performance	<b>'</b>			
Hand Brake	~			
Tyres (lowest observed tread depth of tyres)				
Left front	4	.5	mm	
Right front	5	.0	mm	
Left rear	Left rear 5.4		mm	
Right rear	6.0		mm	
Spare		Yes		
Suspension				
Suspension performance	~			
Steering performance	~			
Shock absorbers	~			
Air Conditioning / Heater				
Operation		~		
Electrical / Accessories				
Head lights	~			
Tail lights	~			
Indicators		~		
Dashboard warning lights	~			
Wipers (front & rear)	~			
Window winder FL	<i>'</i>			
Window winder FR	<i>'</i>			
Window winder RL	<i>'</i>			
Window winder RR	<b>/</b>			
Rear view mirrors	V V V V V			
Radio (basic test only)				
CD (basic test only)	<b>'</b>			
Number of keys	1		l	
Central locking	•			
Remote locking	~			
Sat. Nav. (basic test only)			<i>V</i>	
Reversing camera				

I have read and understood this condition guide.

Name: .....

Signature: .....