

Report ID:	26,049,364	Version:	1
Created:	17 Nov 2025		


Make:	Ford	Model:	Transit
Body Style:	Minibus	Year:	2011
Rego No.:	LAW186	Rego Expiry:	27 Feb 2026
WoF Expiry:	20 Mar 2026	Odometer:	205,765 Kms
Good No.:	26049364	VIN:	WF0DXXTTFDDBE24866
Next Service:	220,000kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

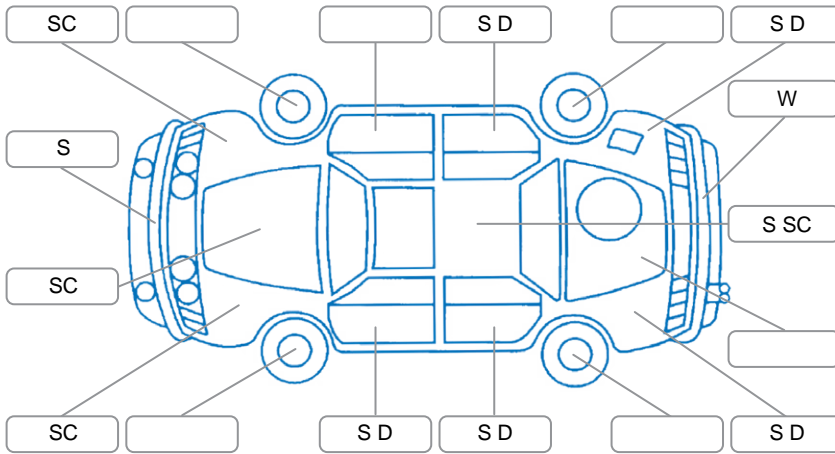

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

12 seater. Minor stone chips on windshield. Left B pillar moulding is missing. Right sill front step paint is worn.

Conditions During Body Inspection

Dry

**Under Carriage and Under Bonnet Inspection Comments**

Leaking from engine. Turbo blow by is weeping. Left rear shock absorber is weeping.

**Interior Comments**

Seats:	Driver's seat base pad is worn, torn.
Carpets:	Average
Panels:	Average
Dashboard:	screw holes.

**General Comments**

Rear AC unit cover is missing clips(left rear). Left back door cardboard is missing. Left front door window switch is not operating. (Can be operated from main switch). AC blower is not operating. Gear shift boot retainer is broken.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Yuki Itohara
Published by:	Glen Charlton
Inspection Date:	17 Nov 2025

I have read and understood  
this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			8.5 mm
Right front			8.0 mm
Left rear			6.5 mm
Right rear			6.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers		✓	
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL		✓	
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓