

Report ID:	26,050,197	Version:	1
Created:	17 Dec 2025		


Make:	Toyota	Model:	Hilux
Body Style:	Utility	Year:	2005
Rego No.:	DAR866	Rego Expiry:	24 Aug 2026
WoF Expiry:	11 Jun 2026	Odometer:	431,346 Kms
Good No.:	26050197	VIN:	MR0CZ12G000003839
Next Service:	No records	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key

S = Scratch R = Rust C = Crack \* = Decals W = Significant scuffs  
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

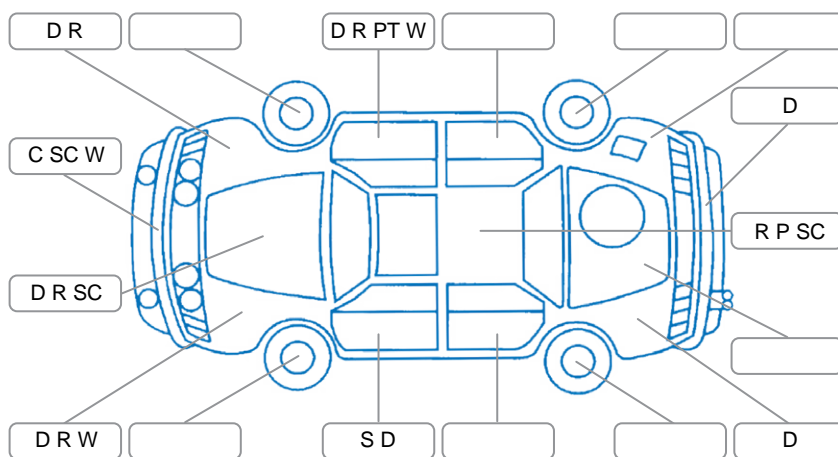

Note: some defects and blemishes may not be displayed in the diagram

## Body Inspection Comments

Screw holes inside of left front guard. Both side edges of front bumper are not fitted correctly. GPS aerial on roof. Rear mad flaps are bent. Surface rust is developing on deck steel. Both sill paint worn. Paint cracked on right cab corner and right door. Minor dent on left cab corner.

Conditions During Body Inspection Dry

## Under Carriage and Under Bonnet Inspection Comments

Minor surface rust is developing underbody.

## Interior Comments

Seats:	Average
Carpets:	Poor
Panels:	Poor
Dashboard:	Average

## General Comments

Left door handle key cover is missing. Both tail lights are cracked. Centre and right air vents are broken. Left drink holder is missing. Clock is missing. Room light bulb is not operating.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No 404,100 Kms
Inspected by:	Yuki Itohara
Published by:	Glen Charlton
Inspection Date:	17 Dec 2025

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			2.5 mm
Right front			3.5 mm
Left rear			3.5 mm
Right rear			2.5 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation			✓
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_