


Make:	Suzuki	Model:	Swift
Body Style:	Hatchback	Year:	2022
Rego No.:	PCQ620	Rego Expiry:	08 Mar 2026
WoF Expiry:	09 Mar 2026	Odometer:	38,773 Kms
Good No.:	26050496	VIN:	JSAAZC83S00405352
Next Service:	47,000kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

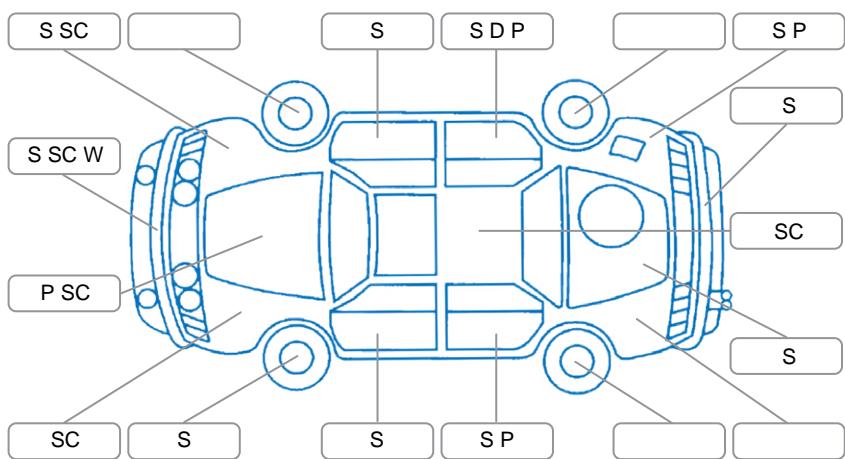

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Three small stone cracks in windscreen, two in right side viewing area of screen, one in left side of screen. Both right & left rear small mud flaps are missing clips. Four holes in boot floor, two right side & two left side, where a bracket has been fitted.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Boot parcel tray is missing. Threaded fittings in left & right rear interior roof panel, where grab handles would fit. Cd player will not load cd's.

Road Conditions During Test Drive	Dry				
Engine Timing Mechanism	Timing Chain				
Evidence of Cam Belt Replacement	<input type="checkbox"/>	Yes	<input type="checkbox"/>	No	Kms
Inspected by:	Jason Young				
Published by:	Jason Young				
Inspection Date:	14 Jan 2026				

I have read and understood
this condition guide:

NAME

Report ID:	26,050,496	Version:	1
Created:	14 Jan 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front		6.5 mm	
Right front		3 mm	
Left rear		5 mm	
Right rear		5.5 mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

SIGNATURE