

Report ID:	26,050,682	Version:	1
Created:	26 Jan 2026		


Make:	Isuzu	Model:	D-MAX
Body Style:	Utility	Year:	2022
Rego No.:	PAJ270	Rego Expiry:	25 Jul 2026
WoF Expiry:	11 Jun 2026	Odometer:	212,726 Kms
Good No.:	26050682	VIN:	MPATFS40JNT003528
Next Service:	190,000kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

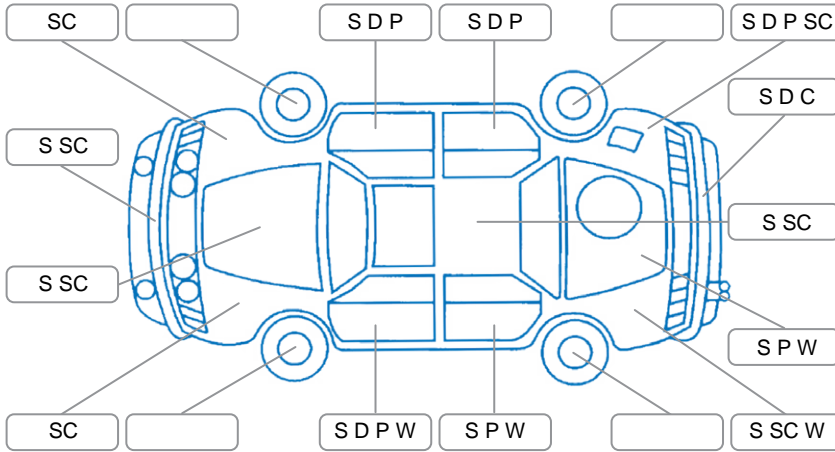

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Large crack across right side of windscreen, small stone cracks across windscreen. Crack in right side corner of rear bumper. Crack & hole in right side repeater lens in right side wing mirror.

Conditions During Body Inspection: Wet

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Average
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Holes in fabric on base pad of driver's seat. Engine oil service is well overdue. Rear parking sensors are not working. Lock catches on rear deck lid are not working/ locking.

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Jason Young
Published by:	Glen Charlton
Inspection Date:	26 Jan 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6.0 mm
Right front			6.0 mm
Left rear			5.0 mm
Right rear			5.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____