


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2019
Rego No.:	LYA447	Rego Expiry:	28 Apr 2026
WoF Expiry:	22 Jan 2026	Odometer:	198,905 Kms
Good No.:	26050726	VIN:	MMAJYKK10JH027815
Next Service:	206,000km's	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

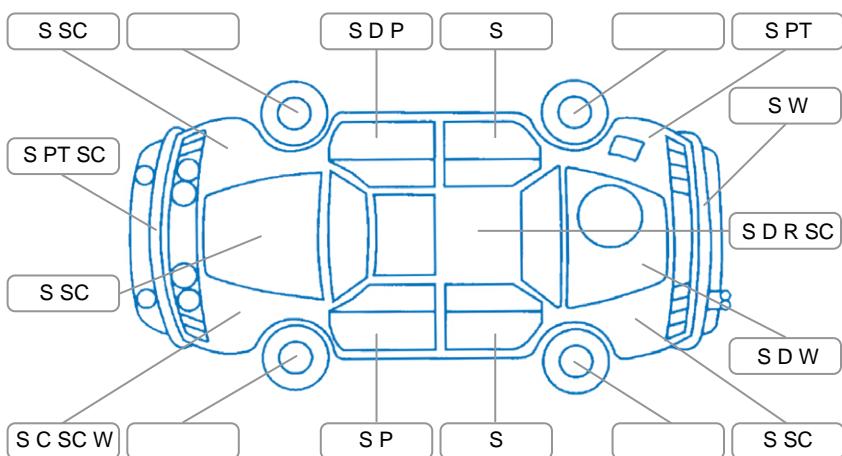

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Large crack in left side of windscreen. Tonneau support bar bracket needs refitted on left side & front tonneau cover mounting studs need refitted. Left side wing mirror surround & housing is cracked and broken. Both rear tyres need replaced. Crack in bottom of left front guard flare

Conditions During Body Inspection	Wet
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Holes on inside lip of right front guard, from where an aerial bracket has been attached.

Interior Comments

Seats:	Good
Carpets:	Average
Panels:	Average
Dashboard:	Good

General Comments

Right front door frame seal is damaged & torn. Hole in carpet in right front foot well area. Centre left air vent in dashboard is broken. Holes in left side of centre console.

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No
Inspected by:	Jason Young
Published by:	Glen Charlton
Inspection Date:	26 Jan 2026

I have read and understood
this condition guide:

NAME _____

Report ID:	26,050,726	Version:	3
Created:	02 Feb 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	7.5 mm		
Right front	7.5 mm		
Left rear	1.0 mm		
Right rear	1.0 mm		
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

SIGNATURE _____