

Report ID:	26,051,079	Version:	1
Created:	17 Feb 2026		


Make:	Mini	Model:	Cooper
Body Style:	Convertible	Year:	2007
Rego No.:	LJC765	Rego Expiry:	11 Feb 2026
WoF Expiry:	16 Sep 2026	Odometer:	156,318 Kms
Good No.:	26051079	VIN:	WMWRF32070TN02374
Next Service:	?	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

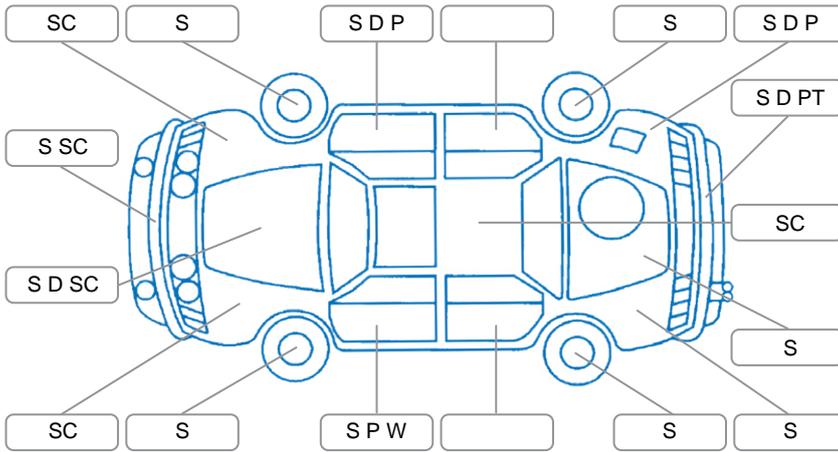

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Windscreen washer bottle is leaking. Bottom of left front guard flare is not fitting up to bumper correctly. Centre cap missing off left front alloy wheel. Radio aerial stalk is missing.

Conditions During Body Inspection: Dry

### Under Carriage and Under Bonnet Inspection Comments

Oil leaking from engine. Radiator/coolant system needs a flush, coolant is very dirty.

### Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Average

### General Comments

Electric switch to adjust wing mirrors is not working & wings arms have been tapped in place. Screw holes in dashboard. Hinge broken on arm rest lid on centre console. Key remote lock button is not working, but unlock button still works.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Jason Young		
Published by:	Glen Charlton		
Inspection Date:	16 Feb 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			6.0 mm
Right front			5.0 mm
Left rear			3.4 mm
Right rear			3.4 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_