

Report ID:	26,051,131	Version:	1
Created:	18 Feb 2026		


Make:	Holden	Model:	Colorado
Body Style:	Utility	Year:	2015
Rego No.:	HZG966	Rego Expiry:	26 Feb 2027
WoF Expiry:	19 Aug 2026	Odometer:	285,240 Kms
Good No.:	26051131	VIN:	MMU148EK0FH614240
Next Service:	291,000kms	Service History:	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

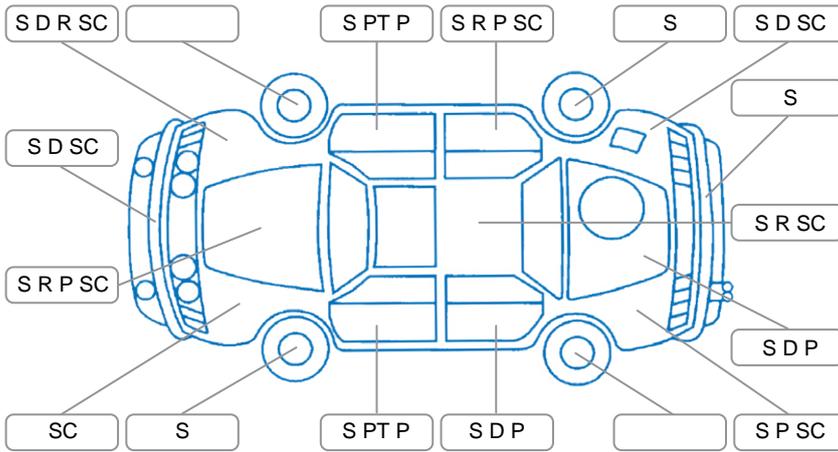

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Large dent in right side bottom corner of front bumper. No key for locks on left side canopy door window.

Conditions During Body Inspection    Dry

**Under Carriage and Under Bonnet Inspection Comments**

**Interior Comments**

Seats:	Good
Carpets:	Good
Panels:	Average
Dashboard:	Good

**General Comments**

Key remote casing has been taped up. Radio is not working. A/C is not getting cold, needs attention. Some of tool for using vehicle jack are missing. Rear backing sensors are not working.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No    Kms
Inspected by:	Jason Young
Published by:	Glen Charlton
Inspection Date:	18 Feb 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			9.0 mm
Right front			9.0 mm
Left rear			9.0 mm
Right rear			9.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_