

Report ID:	26,051,226	Version:	2
Created:	18 Mar 2026		


Make:	Toyota	Model:	Altezza
Body Style:	Sedan	Year:	1998
Rego No.:	RFL316	Rego Expiry:	03 Sep 2026
WoF Expiry:	22 Nov 2025	Odometer:	318,215 Kms
Good No.:	26051226	VIN:	7A8H6390705006455
Next Service:	?	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

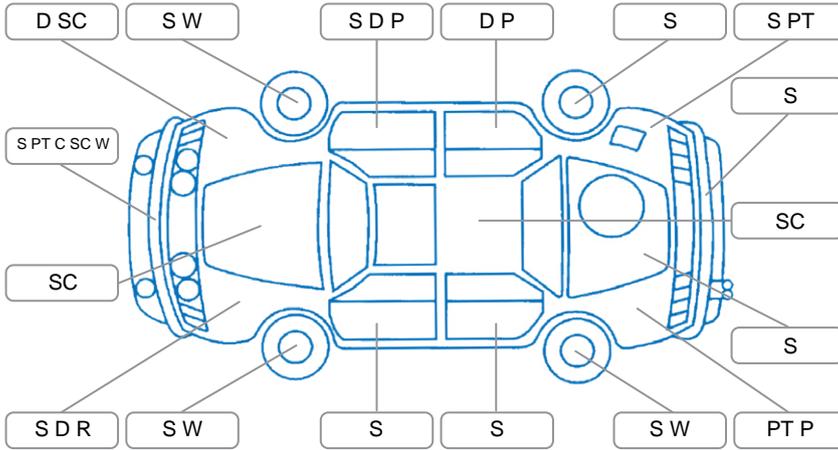

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Lower grille & front spotlights missing from front bumper. Stone tray under front bumper & both front inner guard panels are missing. Radio aerial stork is missing.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Engine leaking oil, very wet around front crank pulley.

Interior Comments

Seats:	Good
Carpets:	Average
Panels:	Average
Dashboard:	Good

General Comments

Very hard riding, has adjustable suspension has certification but not at correct ride height & incorrect suspension arms fitted to match certification. Front seats, wheels & tyres don't match to ones fitted for certification. Driver's seat belt webbing is damaged. Hole in carpet in right front foot well area. Switch for adjusting wing mirrors is not

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Jason Young
Published by:	Jason Young
Inspection Date:	20 Feb 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance		✓	
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6.2 mm
Right front			6.0 mm
Left rear			4.7 mm
Right rear			4.5 mm
Spare		N/A	
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____