

Report ID:	26,051,411	Version:	3
Created:	10 Mar 2026		


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2019
Rego No.:	MBQ901	Rego Expiry:	27 Sep 2026
WoF Expiry:	02 May 2026	Odometer:	128,597 Kms
Good No.:	26051411	VIN:	MMAJYKL10JH014811
Next Service:	138,600kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

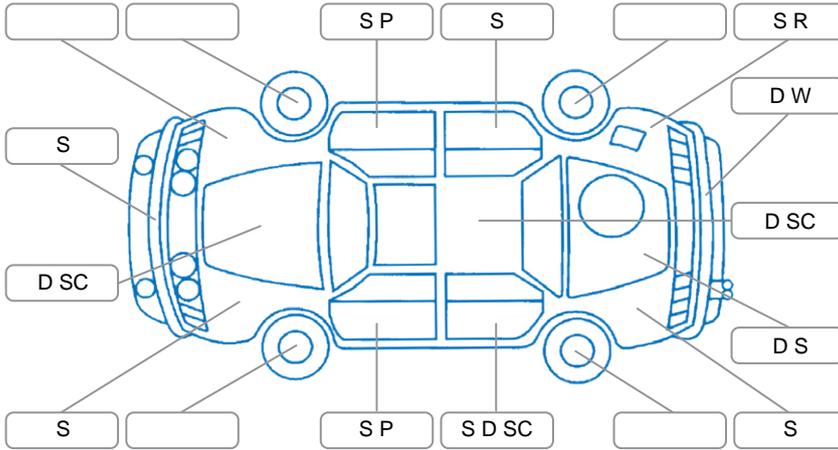

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Rear end of canopy is scuffed. One of LH canopy lock is faulty. Canopy key, roof rack key are missing. Right cab corner has minor dents. Numbers of minor dents on tail gate and left rear door. Dents on roof and right cant rail. Aerial is missing. Paint of rear bumper is cracked.

Conditions During Body Inspection: Wet Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Right front base pad is torn.
Carpets:	Good
Panels:	scratches
Dashboard:	Scratches

General Comments

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Yuki Itohara
Published by:	Glen Charlton
Inspection Date:	03 Mar 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			8.0 mm
Right front			9.0 mm
Left rear			8.0 mm
Right rear			8.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____