

Report ID:	26,055,443	Version:	8
Created:	18 Feb 2026		


Make:	Volkswagen	Model:	Crafter
Body Style:	Van	Year:	2020
Rego No.:	NEA573	Rego Expiry:	23 Nov 2026
WoF Expiry:		Odometer:	58,817 Kms
Good No.:	26055443	VIN:	WV1ZZZSYZM9004211
Next Service:	76000	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

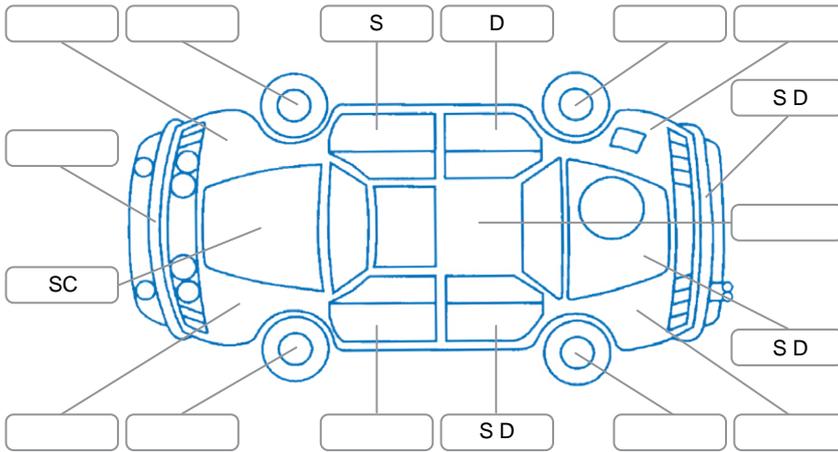

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Left van side molding not secure. Hood lining refit.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

2WD. Oil leaking is from an aftermarket air compressor. This unit appears to be a hydraulic-controlled driveline disconnect device that splits the driveshaft into two sections and allows engagement or disengagement of power transmission. Currently, the hydraulic coupling is leaking oil from the unit housing/seal area.

Interior Comments

Seats:	Driver side torn.
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Engine warning glowing. Engine light scan results codes are for P226D00, P213800, U041600. This could be the throttle body or for a DPF problem. Maybe both.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Rajesh Mayan
Published by:	Ben Nicholson
Inspection Date:	12 Feb 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6.0 mm
Right front			7.0 mm
Left rear			3.0 mm
Right rear			3.0 mm
Spare		No	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____