

| | | | |
|------------|-------------|----------|---|
| Report ID: | 26,069,323 | Version: | 2 |
| Created: | 08 Dec 2025 | | |


| | | | |
|---------------|-------------|------------------|-------------------|
| Make: | Hyundai | Model: | Tucson |
| Body Style: | SUV | Year: | 2016 |
| Rego No.: | JYQ906 | Rego Expiry: | 07 Jul 2026 |
| WoF Expiry: | 28 Jul 2026 | Odometer: | 223,408 Kms |
| Good No.: | 26069323 | VIN: | KMHJ3814MHU229392 |
| Next Service: | 229,000 Kms | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

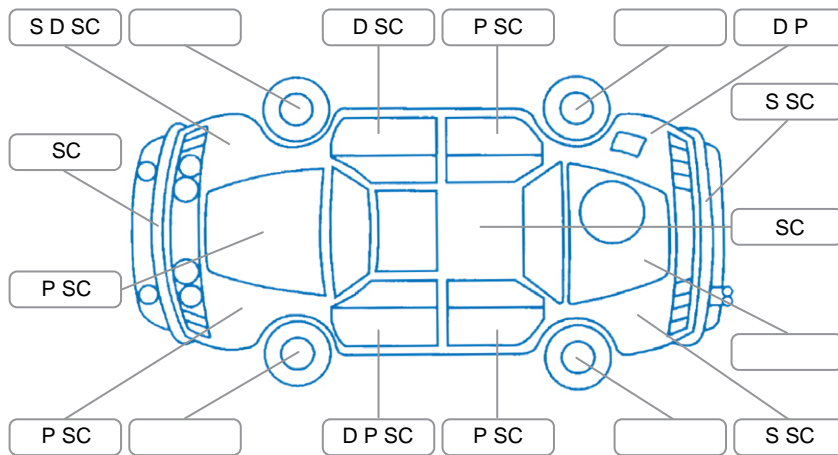

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Dents/scratches on both B pillars in door jam.
Drivers door seal torn.
Stonechip in windscreen.
Missing tow bar tongue.

| | |
|-----------------------------------|-----|
| Conditions During Body Inspection | Dry |
|-----------------------------------|-----|

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

| | |
|------------|--|
| Seats: | Good, minor leather tear on drivers seat base. |
| Carpets: | Average, wearing in drivers footwell. |
| Panels: | Good |
| Dashboard: | Average, steering wheel worn. |

General Comments

Rear window washer not spraying.
LF indicator not working, message on dash.

| | |
|-----------------------------------|--|
| Road Conditions During Test Drive | Dry |
| Engine Timing Mechanism | Timing Chain |
| Evidence of Cam Belt Replacement | <input type="checkbox"/> Yes <input type="checkbox"/> No Kms |
| Inspected by: | Troy Smith |
| Published by: | Troy Smith |
| Inspection Date: | 08 Dec 2025 |

| | OK | Requires Attention | N/A |
|--|----|--------------------|-----|
|--|----|--------------------|-----|

Engine

| | | | |
|---------------------------|---|--|--|
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Engine performance | ✓ | | |
| Noise | ✓ | | |
| Coolant condition | ✓ | | |
| Cooling performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |

Transmission

| | | | |
|----------------|---|--|---|
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |

Brakes

| | | | |
|-------------|---|--|--|
| Performance | ✓ | | |
| Hand brake | ✓ | | |

Tyres (lowest observed tread depth of tyres)

| | |
|-------------|--------|
| Left front | 3 mm |
| Right front | 3.5 mm |
| Left rear | 2.5 mm |
| Right rear | 3.5 mm |
| Spare | Yes |

Suspension

| | | | |
|------------------------|---|--|--|
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |

Air Conditioning / Heater

| | | | |
|-----------|---|--|--|
| Operation | ✓ | | |
|-----------|---|--|--|

Electrical / Accessories

| | | | |
|-----------------------------|---|---|---|
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | | ✓ | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | | ✓ | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | | | ✓ |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____