


Report ID:	26,084,407	Version:	1
Created:	04 Mar 2026		

Make:	Subaru	Model:	Impreza
Body Style:	Hatchback	Year:	2009
Rego No.:	PSA822	Rego Expiry:	28 Feb 2026
WoF Expiry:	18 Jun 2026	Odometer:	184,595 Kms
Good No.:	26084407	VIN:	7AT0GF09X22002662
Next Service:	N/A	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

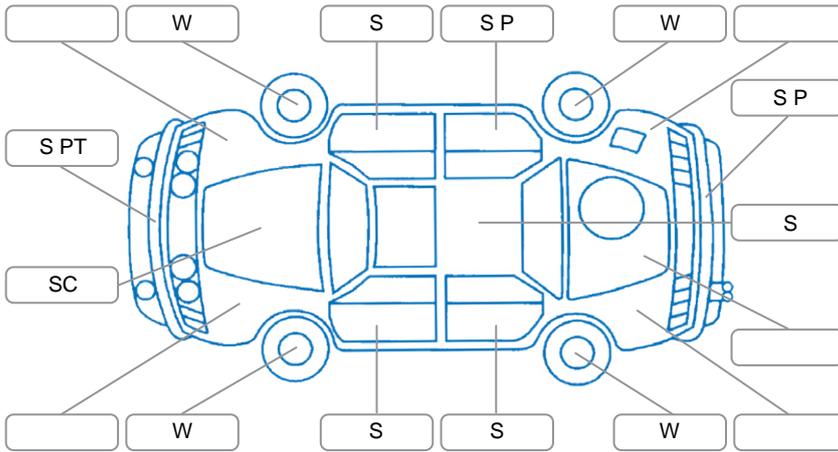

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Large stone chips in front windscreen  
 Front bumper headlight washer covers missing, bumper loose and needs to be secured

Conditions During Body Inspection    Dry

### Under Carriage and Under Bonnet Inspection Comments

AWD  
 Engine oil seep

### Interior Comments

Seats:	Slight wear on drivers side
Carpets:	Slight wear on drivers side
Panels:	Good
Dashboard:	Wear on steering wheel

### General Comments

Two key remotes, one isn't working

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Cambelt		
Evidence of Cam Belt Replacement	<input checked="" type="checkbox"/> Yes	<input type="checkbox"/> No	95,758 Kms
Inspected by:	Hoani Saunders		
Published by:	Robert Chardon		
Inspection Date:	10 Feb 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5.0 mm
Right front			5.1 mm
Left rear			4.0 mm
Right rear			4.2 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_