

Report ID:	26,127,163	Version:	1
Created:	13 Feb 2026		


Make:	Mazda	Model:	Bt-50
Body Style:	Utility	Year:	2013
Rego No.:	GRA258	Rego Expiry:	01 Feb 2026
WoF Expiry:	02 Aug 2026	Odometer:	241,018 Kms
Good No.:	26127163	VIN:	MMOUP0YF100148417
Next Service:	242,000 Kms	Service History:	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

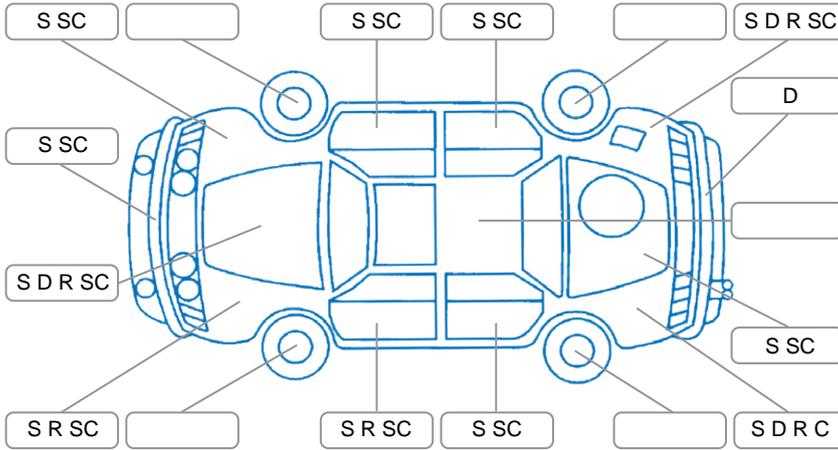

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Poor paint work clear coat coming off and faded. Dent lhs C pillar. Rear bumper hit rear bodywork due to large dent/impact and now has poor fit. Vehicle has been lifted. Driver side door handle gets stuck when opening

Conditions During Body Inspection

Wet

### Under Carriage and Under Bonnet Inspection Comments

At inspection No coolant bottle cap-and bottle emptied. Saw it in chassis and had to remove belly pans to get it. Filled with water only and cannot guarantee the engine hasn't suffered from it as a result.

Battery passed

### Interior Comments

Seats:	driver split,marks
Carpets:	Average
Panels:	scratches scuffs marks
Dashboard:	Average

### General Comments

Air conditioning poor,heater ok. Lh brake light nw. Rhf park light nw. Only window working is driver. Roof lining marked. Sunglasses holder broken

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Gary Adams
Published by:	Amanda Loader
Inspection Date:	13 Feb 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)		✓	
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			6.0 mm
Right front			6.0 mm
Left rear			7.0 mm
Right rear			7.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL		✓	
Window winder FR	✓		
Window winder RL		✓	
Window winder RR		✓	
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_