

Report ID:	26,127,911	Version:	2
Created:	28 Apr 2026		


Make:	Mazda	Model:	Axela
Body Style:	Sedan	Year:	2014
Rego No.:	RBZ799	Rego Expiry:	08 Mar 2026
WoF Expiry:		Odometer:	125,062 Kms
Good No.:	26127911	VIN:	7AT0C13JX25104210
Next Service:	121,724 Kms	Service History:	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

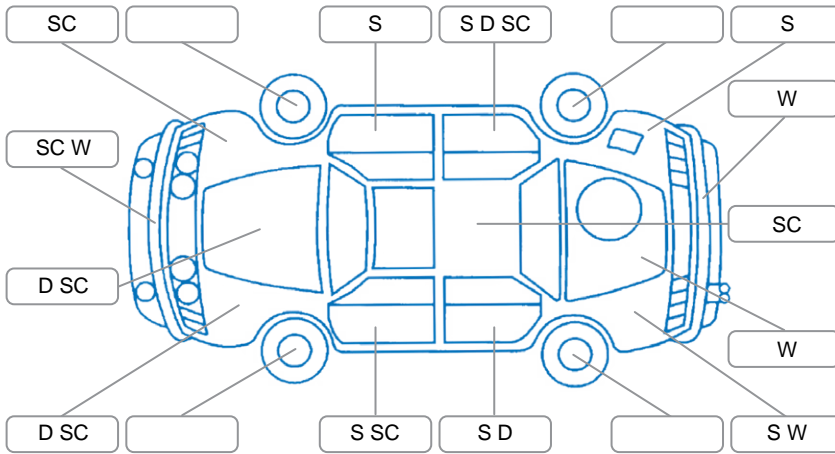

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

No spare or inflation kit provided.  
 Rear tyres do not match RR directional LR symmetrical.  
 LF tyre worn inner edge.

Conditions During Body Inspection	Dry
-----------------------------------	-----

### Under Carriage and Under Bonnet Inspection Comments

Battery in compartment.  
 Rear brakes at 3mm.

### Interior Comments

Seats:	Average
Carpets:	Average
Panels:	scuffs
Dashboard:	glovebox has scuffs.

### General Comments

License plate lights not working. LF wing mirror not working.  
 Centre rear view mirror loose.  
 Air conditioning and heating ok along with reversing camera working at time of inspection.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Finlay Lemmens
Published by:	Amanda Loader
Inspection Date:	10 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			3.0 mm
Right front			3.0 mm
Left rear			6.0 mm
Right rear			4.0 mm
Spare		N/A	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)		✓	
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_