

Report ID:	26,128,286	Version:	3
Created:	08 Apr 2026		


Make:	Honda	Model:	Vezel
Body Style:	Wagon	Year:	2014
Rego No.:	NRL40	Rego Expiry:	10 Aug 2023
WoF Expiry:	17 Nov 2024	Odometer:	201,119 Kms
Good No.:	26128286	VIN:	7AT08GDHX21037445
Next Service:	overdue	Service History:	Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

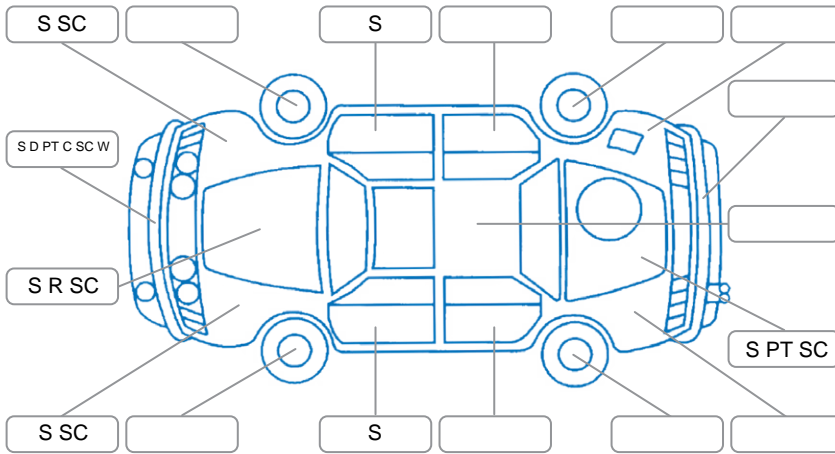

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Both front tires bald on inner edge and RHF on outer also.  
 Front bumper damaged badly.  
 Stone chips scratched scuffed dents all over

Conditions During Body Inspection    Dry

**Under Carriage and Under Bonnet Inspection Comments**

Requires front brakes.  
 Signs of oil leak.  
 Battery dead required jumping ( had 95cca and rated as 350 )

**Interior Comments**

Seats:	marks
Carpets:	Average
Panels:	scratches scuffs marks
Dashboard:	Average

**General Comments**

Air conditioning and heating systems along with reverse camera ok.  
 Wiring type noise from engine but service overdue approximately 50k.  
 Both mirrors make noises and won't retract and LHS doesn't lock into place  
 Vehicle Rego is currently on hold

Road Conditions During Test Drive    Dry

Engine Timing Mechanism    Timing Chain

Evidence of Cam Belt Replacement     Yes     No    Kms

Inspected by: Gary Adams

Published by: Amanda Loader

Inspection Date: 24 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance		✓	
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			3.0 mm
Right front			2.0 mm
Left rear			5.0 mm
Right rear			5.0 mm
Spare		N/A	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_