

Report ID:	26,131,410	Version:	2
Created:	17 Jul 2026		


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2020
Rego No.:	MWT291	Rego Expiry:	14 Jul 2026
WoF Expiry:	25 Sep 2026	Odometer:	123,590 Kms
Good No.:	26131410	VIN:	MMAJLKL10LH016615
Next Service:	overdue	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

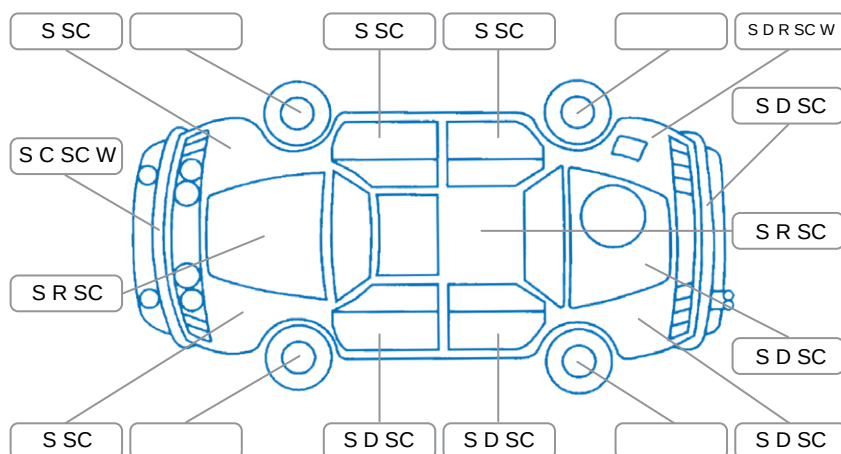

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Rhf tire inner edge wearing.
No canopy keys. Stone chips with cracks in front screen.
Rear bumper poor fit

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Battery failed.
Huge oil leak.
Rhr axle potential seal leak.
Brake fluid low. Oil low

Interior Comments

Seats:	marks, hole driver
Carpets:	hole driver footwell
Panels:	scratches scuffs marks
Dashboard:	Average

General Comments

Air conditioning and heating systems along with reverse camera working at time of inspection.

RHR window and door buttons not working

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	☐ Yes	☐ No	Kms
Inspected by:	Gary Adams		
Published by:	Amanda Loader		
Inspection Date:	15 Jul 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	4.0 mm		
Right front	5.0 mm		
Left rear	4.0 mm		
Right rear	5.0 mm		
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL		✓	
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood
this condition guide:

NAME _____

SIGNATURE