


<b>Make:</b>	Mitsubishi	<b>Model:</b>	Outlander	<b>Body Style:</b>	Wagon
<b>Year:</b>	2006	<b>Registration:</b>	MPC753	<b>Reg Expiry:</b>	31 Dec 2024
<b>WoF Expiry:</b>	03 Oct 2025	<b>Odometer:</b>	270,512 Kms	<b>Good No:</b>	26671517
<b>VIN:</b>	7AT0CJ3MX19026133	<b>Next Service:</b>	230,000	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

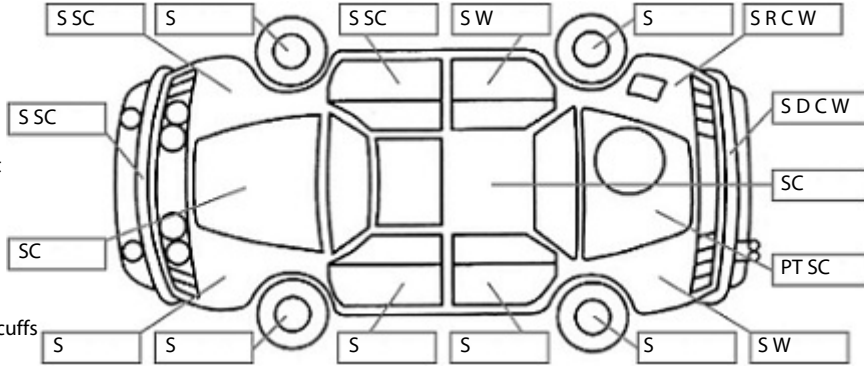

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Front & rear bumpers need alignment, right rear reflector missing, drivers weather shield is broken, drivers window tint ripped,

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Oil leaks, oil level low,

**Interior Comments**

Seats	wear and tear
Carpets	Average
Panels	sunglasses holder is missing
Dashboard	Good

**General Comments**

Steering wheel covered in tape, left front headlight not working, drivers air vent damaged, engine has a whining noise, there is a rubbing noise in the rear,

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level		✓	
Smoke & fumes	✓		
Performance	✓		
Noise		✓	
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	4.6	mm	
Right front	4.8	mm	
Left rear	4.7	mm	
Right rear	6.0	mm	
Spare	No		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jesse Roberts

Date: 19 Mar 2025

I have read and understood this condition guide. Name: ..... Signature: .....