


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Mazda | Model: | Axela | Body Style: | Hatchback |
| Year: | 2009 | Registration: | MSF411 | Reg Expiry: | 13 Aug 2025 |
| WoF Expiry: | 13 Mar 2026 | Odometer: | 204,024 Kms | Good No: | 26756971 |
| VIN: | 7AT0C13JX20102513 | Next Service: | overdue | Service History: | Yes |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

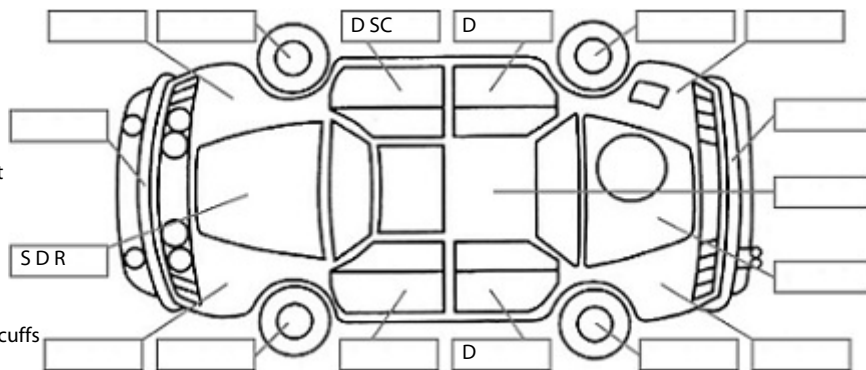

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Something rattling around in tailgate. Signs of water coming into the spare wheel well. Paint faded. Headlights faded. Stone chips in front screen. Rear bumper damaged

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Brakes getting low. Partial belly pans. Brake fluid low. Oil level approximately 1/2. Didn't test battery as no information on it

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Poor |

General Comments

Remote nw. Knock noise rhr suspension area. Air conditioning and heating systems good temperature at inspection time. Rear wiper smears

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | | ✓ | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | | ✓ | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 4.0 | mm | |
| Right front | 4.0 | mm | |
| Left rear | 7.0 | mm | |
| Right rear | 7.0 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | | ✓ | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | | ✓ | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Gary Adams

Date: 29 Apr 2025

I have read and understood this condition guide.

Name:

Signature: