


<b>Make:</b>	Mazda	<b>Model:</b>	Demio	<b>Body Style:</b>	Hatchback
<b>Year:</b>	2009	<b>Registration:</b>	KBR338	<b>Reg Expiry:</b>	16 Mar 2026
<b>WoF Expiry:</b>	26 Jun 2025	<b>Odometer:</b>	154,893 Kms	<b>Good No:</b>	26773329
<b>VIN:</b>	7AT0C12HX16266459	<b>Next Service:</b>	163,017km	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

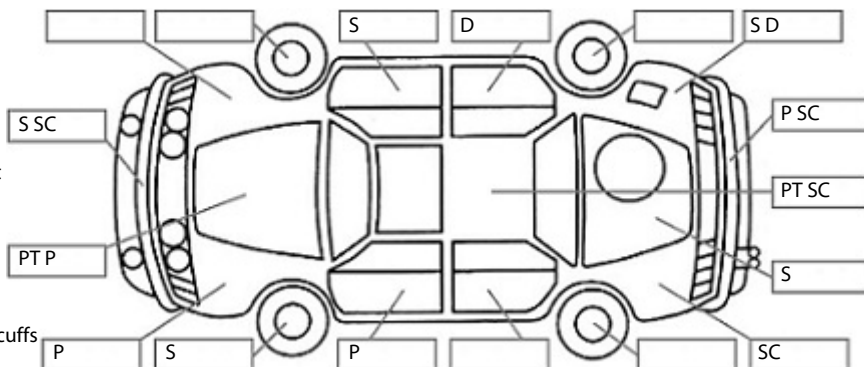

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Left side of front bumper fits poorly.  
Mould on top surfaces will need a polish to remove.  
Right wing mirror housing is broken.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Engine oil leak.

**Interior Comments**

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

**General Comments**

Left wing mirror mechanism broken & wont adjust or retract.  
L & R Mirror button needs to be held down firmly for right mirror to adjust.  
CD won't eject, disc stuck in player.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	2.5	mm	
Right front	3	mm	
Left rear	6	mm	
Right rear	6	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Blair Robertson

Date: 05 May 2025

I have read and understood this condition guide.

Name: .....

Signature: .....