


<b>Make:</b>	Nissan	<b>Model:</b>	Elgrand	<b>Body Style:</b>	Wagon
<b>Year:</b>	2004	<b>Registration:</b>	JBK553	<b>Reg Expiry:</b>	07 Oct 2025
<b>WoF Expiry:</b>	05 Dec 2025	<b>Odometer:</b>	169,290 Kms	<b>Good No:</b>	26779584
<b>VIN:</b>	7AT0DH6MX15104031	<b>Next Service:</b>	0	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

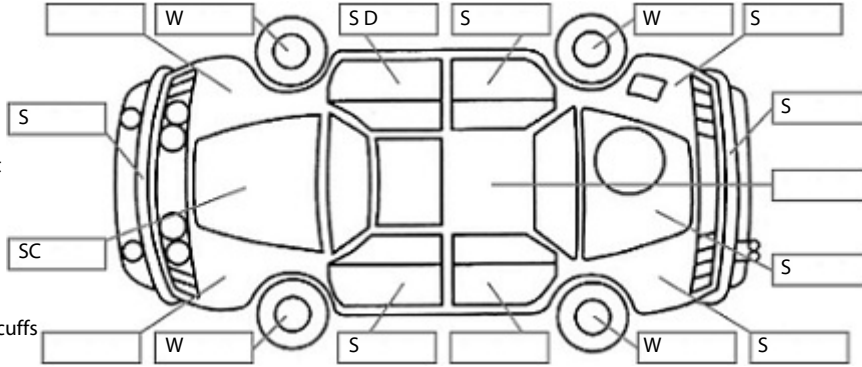

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Head lamp faded. Steering wheel torn. Steering wheel torn.  
Rear seat adjuster struck up. Second row seat trim broken.  
Second row seat rail rust. Tailgate trim broken. Display faulty.  
Map lamp not glow. Rear window switch not work some time.

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

4Wheel drive.  
Engine oil seepage.  
TM oil seepage. Steering rack oil seepage.  
Underbody surface rust.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Poor
Dashboard	Average

**General Comments**

Vehicle pulling LH side W/A required.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	8	mm	
Right front	9	mm	
Left rear	8	mm	
Right rear	8	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Rajesh Mayan

Date: 29 May 2025

I have read and understood this condition guide. Name: ..... Signature: .....