


<b>Make:</b>	Nissan	<b>Model:</b>	X-Trail	<b>Body Style:</b>	Wagon
<b>Year:</b>	2009	<b>Registration:</b>	MHG674	<b>Reg Expiry:</b>	30 Jun 2025
<b>WoF Expiry:</b>	10 Apr 2026	<b>Odometer:</b>	218,501 Kms	<b>Good No:</b>	26788663
<b>VIN:</b>	7AT0DH6LX19040948	<b>Next Service:</b>		<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

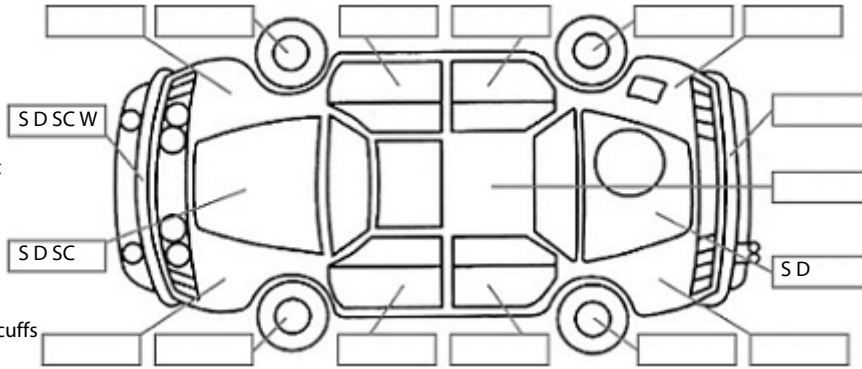

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Headlights faded. Grill loose. Front bumper damaged. Overall condition poor with scratches dents stone chips all over Requires tailgate struts

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Runs on 91 octane fuel. Brake fluid low. Tested battery and failed. Oil leak

**Interior Comments**

Seats	cracked and holes
Carpets	Poor
Panels	scratches scuffs marks
Dashboard	Average

**General Comments**

When rear wiper wash selected front also goes. Driver window nw when button fully pressed, but back off a bit and ok. Rattling in exhaust potentially. Rear suspension noises. Air conditioning and heating systems good temperature at inspection but has odours. Driver mirror glass fell out on road test

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance		✓	
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	6.0	mm	
Right front	6.0	mm	
Left rear	6.0	mm	
Right rear	6.0	mm	
Spare	N/A		
<b>Suspension</b>			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR		✓	
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Gary Adams

Date: 14 May 2025

I have read and understood this condition guide.

Name: .....

Signature: .....