


<b>Make:</b>	Ford	<b>Model:</b>	F150	<b>Body Style:</b>	Utility
<b>Year:</b>	1994	<b>Registration:</b>	JKE188	<b>Reg Expiry:</b>	13 Apr 2026
<b>WoF Expiry:</b>	27 Sep 2025	<b>Odometer:</b>	174,484 Kms	<b>Good No:</b>	26796477
<b>VIN:</b>	1FTEF15N5RNB76041	<b>Next Service:</b>	184,216kms	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

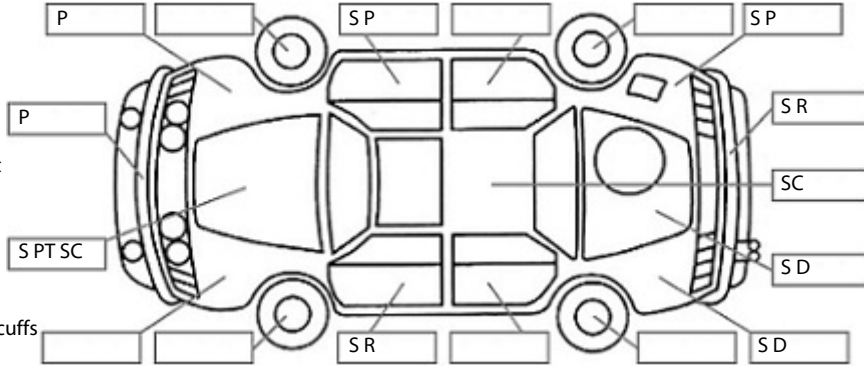

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Radio aerial stork has been broken off. No keys for lock on rear deck lid. Nudge bar on front bumper has surface rust. Paint worn on bonnet & rear deck lid. Dashboard display surround not secured in place correctly. Crack in both rear taillight lenses. Right side wiper blade needs replaced.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Oil leaks from engine. Underbody surface rust.

**Interior Comments**

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

**General Comments**

Coolant system/ radiator needs a flush. Interior head lining is sagging. Left side indicator light is not flashing on dash display when indicator is on. A/C is not getting very cold. Central locking is not working. Lumbar switch on drivers seat is not working. Gas struts on rear deck lid not working, need replaced.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	8.0	mm	
Right front	6.0	mm	
Left rear	5.6	mm	
Right rear	4.2	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking		✓	
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 16 May 2025

I have read and understood this condition guide. Name: ..... Signature: .....