


|               |             |                  |                   |
|---------------|-------------|------------------|-------------------|
| Make:         | Holden      | Model:           | Equinox           |
| Body Style:   | SUV         | Year:            | 2021              |
| Rego No.:     | NFM370      | Rego Expiry:     | 05 Jan 2026       |
| WoF Expiry:   | 31 Oct 2026 | Odometer:        | 243,860 Kms       |
| Good No.:     | 27143748    | VIN:             | 3G0AX7EX1LS688874 |
| Next Service: |             | Service History: | No                |

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key

S = Scratch R = Rust C = Crack \* = Decals W = Significant scuffs  
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

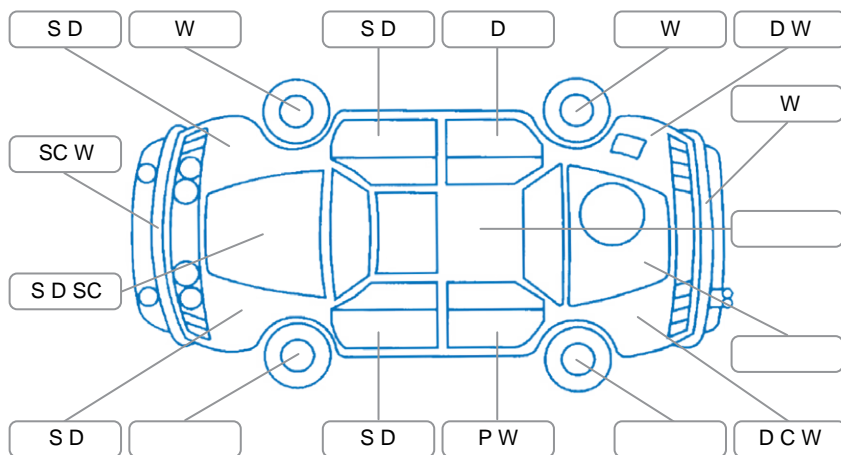

Note: some defects and blemishes may not be displayed in the diagram

## Body Inspection Comments

Stone chips in windscreen.  
Holes in front and rear bumper.

Conditions During Body Inspection

Dry

## Under Carriage and Under Bonnet Inspection Comments

Oil seepage around valve cover and under engine.

## Interior Comments

|            |  |
|------------|--|
| Seats:     | Average  |
| Carpets:   | Poor   |
| Panels:    | Average  |
| Dashboard: | dashboard cover missing , screw holes in dash. |

## General Comments

Vehicle drove ok.  
Whiney sound coming from engine.  
Missing boot well cover.  
Missing sunglasses holder.

|                                   |  |
|-----------------------------------|--|
| Road Conditions During Test Drive | Dry  |
| Engine Timing Mechanism           | Timing Chain   |
| Evidence of Cam Belt Replacement  | <input type="checkbox"/> Yes <input type="checkbox"/> No Kms |
| Inspected by:                     | Aaron Johnson  |
| Published by:                     | Aaron Johnson  |
| Inspection Date:                  | 06 Nov 2025  |

|            |             |          |   |
|------------|-------------|----------|---|
| Report ID: | 27,143,748  | Version: | 1 |
| Created:   | 06 Nov 2025 |          |   |

|   | OK | Requires Attention | N/A  |
|---|----|--------------------|------|
| <b>Engine</b>                                       |    |                    |      |
| Oil level   | ✓  |                    |      |
| Smoke & fumes                                       | ✓  |                    |      |
| Engine performance                                  | ✓  |                    |      |
| Noise   |    | ✓                  |      |
| Coolant condition                                   | ✓  |                    |      |
| Cooling performance                                 | ✓  |                    |      |
| Radiator / Hoses (visual)                           | ✓  |                    |      |
| <b>Transmission</b>                                 |    |                    |      |
| Operation   | ✓  |                    |      |
| Noise   | ✓  |                    |      |
| Clutch  |    |                    | ✓    |
| CV joints   | ✓  |                    |      |
| Wheel bearings                                      | ✓  |                    |      |
| <b>Brakes</b>                                       |    |                    |      |
| Performance   | ✓  |                    |      |
| Hand brake  | ✓  |                    |      |
| <b>Tyres (lowest observed tread depth of tyres)</b> |    |                    |      |
| Left front  |    |                    | 3 mm |
| Right front   |    |                    | 3 mm |
| Left rear   |    |                    | 5 mm |
| Right rear  |    |                    | 5 mm |
| Spare   |    | Yes                |      |
| <b>Suspension</b>                                   |    |                    |      |
| Suspension performance                              | ✓  |                    |      |
| Steering performance                                | ✓  |                    |      |
| Shock absorbers                                     | ✓  |                    |      |
| <b>Air Conditioning / Heater</b>                    |    |                    |      |
| Operation   | ✓  |                    |      |
| <b>Electrical / Accessories</b>                     |    |                    |      |
| Head lights   | ✓  |                    |      |
| Tail lights   | ✓  |                    |      |
| Indicators  | ✓  |                    |      |
| Dashboard warning lights                            | ✓  |                    |      |
| Wipers (front & rear)                               | ✓  |                    |      |
| Window winder FL                                    | ✓  |                    |      |
| Window winder FR                                    | ✓  |                    |      |
| Window winder RL                                    | ✓  |                    |      |
| Window winder RR                                    | ✓  |                    |      |
| Rear view mirrors                                   | ✓  |                    |      |
| Radio (basic test only)                             | ✓  |                    |      |
| CD (basic test only)                                |    |                    | ✓    |
| Number of keys                                      | 2  |                    |      |
| Central locking                                     | ✓  |                    |      |
| Remote locking                                      | ✓  |                    |      |
| Sat. nav. (basic test only)                         | ✓  |                    |      |
| Reversing camera                                    | ✓  |                    |      |

I have read and understood this condition guide: \_\_\_\_\_

NAME

SIGNATURE