


Report ID:	27,151,980	Version:	4
Created:	20 Nov 2025		

Make:	Mitsubishi	Model:	Canter
Body Style:	Van	Year:	1998
Rego No.:	XK4934	Rego Expiry:	05 Jan 2026
WoF Expiry:	20 May 2026	Odometer:	226,536 Kms
Good No.:	27151980	VIN:	JMAFB511B0NR00020
Next Service:	236,555 kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

ney				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

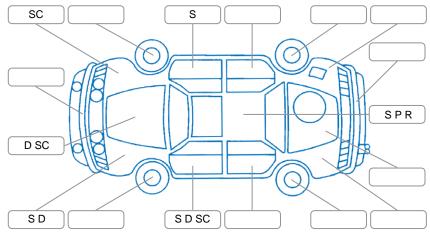

Note: some defects and blemishes may not be displayed in the diagram $\,$

Body Inspection Comments

Right headlight chipped & park light cracked.

Right wing mirror casing damaged & glass delaminating.

Conditions During Body Inspection	Dry
Under Carriage and Under Bonnet Inspection Comm	ents

surface rust on chassis.

Oil leaks

Interior Comm	nents
Seats:	Drivers seat ripped.
Carpets:	Holes torn on drivers side.
Panels:	Left door panel broken at bottom.
Dashboard:	Average

General Comments

Service history records to 1999 only .

Road Conditions During Test Drive		s During Test Drive	Dry
Engine Timing Mechanism		Mechanism	Timing Chain
Evidence of Cam Belt Replacement		n Belt Replacement	Yes No Kms
	Inspected by:	Daryll Timms	
	Published by:	Dean Sinclair	
	Inspection Date:	29 Oct 2025	

I have read and understood
this condition guido:

NAME			

	ОК	Requires Attention	N/A
Engine	OK	Attention	IN/A
Oil level	V		
Smoke & fumes	~		
Engine performance	1		
Noise	\(\tau \)		
Coolant condition	V		
Cooling performance	V		
Radiator / Hoses (visual)	/		
Transmission			
Operation	/		
Noise	~		
Clutch	/		
CV joints			1
Wheel bearings	/		
Brakes			
Performance	/		
Hand brake	/		
Tyres (lowest observed tread d	epth of	tyres)	
Left front		9	9.0 mm
Right front		10).0 mm
Left rear		2	2.0 mm
Right rear		6	6.0 mm
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	/		
Shock absorbers	/		
Air Conditioning / Heater			
Operation			~
Electrical / Accessories			
Head lights	~		
Tail lights	/		
Indicators	V V		
Dashboard warning lights			
Wipers (front & rear)	/		
Window winder FL	/		
Window winder FR	✓		
Window winder RL			•
Window winder RR			•
Rear view mirrors			•
Radio (basic test only)	✓		
CD (basic test only)			/
Number of keys	1	<u> </u>	
Central locking			/
Remote locking			/
Sat. nav. (basic test only)			/
Reversing camera			

SIGNATURE		