

Basic Condition Guide

•	Report ID:	27,163,393	Version:	1
	Created:	11 Nov 2025		


Make:	Honda	Model:	Odyssey
Body Style:	Wagon	Year:	2005
Rego No.:	MZN547	Rego Expiry:	05 Nov 2025
WoF Expiry:	06 Aug 2026	Odometer:	138,470 Kms
Good No.:	27163393	VIN:	7AT08G61X18117305
Next Service:	140,559km	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle ha been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Kev

,				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

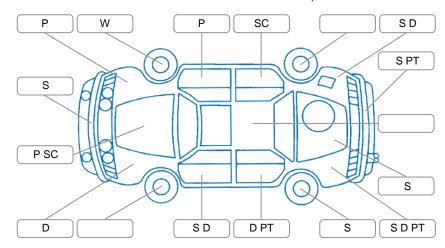

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

R Pillar B dented and gouged. LF seat base pad torn. RF seat base pad worn. Centre seat base pad torn. R tail light cracked. LR door seal torn. Rear seats missing. Hoodlining stains. L sill scratches.

Conditions During Body Inspection Dry	Under Carriage and Under Bonnet Inspection	Comments	
	Conditions During Body Inspection	Dry	

Rust in spare tyre well.

Interior Comments	
Seats:	Average
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments FWD. Service and handbooks missing.

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Sharnae Smith	
Published by:	Sharnae Smith	
Inspection Date:	11 Nov 2025	

	ОК	Requires Attention	N/A
Engine			
Oil level	~		
Smoke & fumes	/		
Engine performance	\(\text{\texi{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\tinx{\text{\texi{\text{\text{\text{\text{\text{\text{\text{\tin}\exititt{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\texi{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\ti}\text{\text{\text{\tinit}\xi{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\tinit}\xi{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\text{\texi\tinit}\\ \tittt{\text{\text{\text{\text{\text{\text{\text{\texi}\tinit}\\ \tittt{\text{\text{\text{\text{\text{\text{\text{\ti}\tittitt{\text{\text{\text{\text{\text{\texi}\tittitt{\text{\text{\text{\text{\texi}\tittit{\text{\texi}\tittt{\text{\text{\texi}\tittitt{\text{\texi}\tittitt{\texi}\tittitt{\text{\texi{\texi{\texi{\texi}\tittitt{\tiinttit{\texitit}\tittit{\text{\tii}\tint		
Noise	✓		
Coolant condition	/		
Cooling performance	/		
Radiator / Hoses (visual)	/		
Transmission			
Operation	/		
Noise	/		
Clutch			1
CV joints	/		
Wheel bearings	/		
Brakes			
Performance	/		
Hand brake	/		
Tyres (lowest observed tread d	epth of	tyres)	
Left front		<u> </u>	5 mm
Right front			6 mm
Left rear			4 mm
Right rear			4 mm
Spare	Yes		
Suspension			
Suspension performance	~		
Steering performance	/		
Shock absorbers	/		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	/		
Window winder RL	/		
Window winder RR	/		
Rear view mirrors	/		
Radio (basic test only)	/		
CD (basic test only)			~
Number of keys	2		
Central locking	/		
Remote locking	/		
Sat. nav. (basic test only)	/		
Reversing camera	✓		
	-	<u> </u>	

I have read and understood this condition guide:

NAME SIGNATURE