

Basic Condition Guide

•	Report ID:	27,172,298	Version:	1
	Created:	10 Nov 2025		


Make:	Volkswagen	Model:	Golf
Body Style:	Hatchback	Year:	2007
Rego No.:	HKC701	Rego Expiry:	13 Jul 2026
WoF Expiry:	31 Oct 2025	Odometer:	197,688 Kms
Good No.:	27172298	VIN:	WVWZZZ1KZ7U020289
Next Service:	due now	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle ha been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Kev

,				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

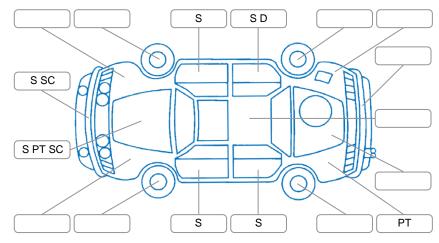

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Lhf tire bald inner edge. No parcel tray. Clear coat coming off an faded paint in several areas

Conditions During Body Inspection	Dry

Under Carriage and Under Bonnet Inspection Comments

Battery failed. Requires oil top up

Interior Comments		
Seats:	marks	
Carpets:	Average	
Panels:	fabric loose/coming off	
Dashboard:	Average	

General Comments

Engine light on and engine misfires. Rhs brake light nw. Requires wheel alignment. Central lock nw lhr door. Wipers smear

		1		
Road Conditions During Test Drive		Dry		
Engine Timing Mechanism		Cambelt		
Evidence of Cam Belt Replacement		✓ Yes	No	68,967 Kms
Inspected by:	Gary Adams			
Published by:	Saxon Ewen			
Inspection Date:	07 Nov 2025		,	

	OK	Requires Attention	N/A
Engine	<u> </u>	Accention	14/71
Oil level	V		1
Smoke & fumes	1		
Engine performance		/	
Noise	1		
Coolant condition	1		
Cooling performance	V		
Radiator / Hoses (visual)	1		
Transmission			
Operation	V		
Noise	1		
Clutch			1
CV joints	1		
Wheel bearings	1		
Brakes			
Performance	V		
Hand brake	1		
Tyres (lowest observed tread d	epth of	tyres)	
Left front		,	1.0 mm
Right front		3	3.0 mm
Left rear			4.0 mm
Right rear			5.0 mm
Spare	Yes		
Suspension			
Suspension performance	V		
Steering performance		1	
Shock absorbers	1		
Air Conditioning / Heater			
Operation	/		
Electrical / Accessories			
Head lights	/		
Tail lights	1		
Indicators	1		
Dashboard warning lights	1		
Wipers (front & rear)		~	
Window winder FL	1		
Window winder FR	1		
Window winder RL	1		
Window winder RR	1		
Rear view mirrors	1		
Radio (basic test only)	1		
CD (basic test only)	1		
Number of keys	2		
Central locking		1	
Remote locking	•		
Sat. nav. (basic test only)			~
Reversing camera	1		
neversing carriera			<u> </u>

I have read and understood this condition guide: