

# **Basic Condition Guide**

Report ID:	27,172,570	Version:	1
Created:	11 Nov 2025		


Make:	Subaru	Model:	Exiga
Body Style:	Wagon	Year:	2008
Rego No.:	QWU927	Rego Expiry:	25 Dec 2025
WoF Expiry:	18 Nov 2026	Odometer:	170,442 Kms
Good No.:	27172570	VIN:	7AT0GF1RX18003974
Next Service:	overdue 169557	Service History:	No

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle ha been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

#### Kev

,				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

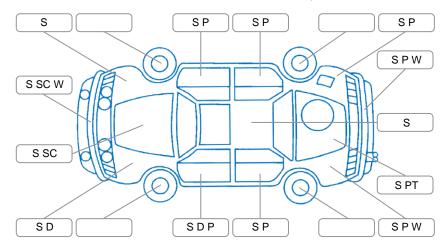

Note: some defects and blemishes may not be displayed in the diagram

### **Body Inspection Comments**

Rear view mirror delaminating. Door lock button on drivers door not working. Paint on drivers seatbelt. Oil low. Headlights yellowing. Rear bumper misaligned. Wingmirrors paint peel.

Conditions During Body Inspection	Dry
Under Carriage and Under Ronnet Inspection Comm	ents

Rear subframe minor rust starting. Underbody rust.

Interior Comm	ents
Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

## **General Comments**

CVs creaking,

Front r suspension noisy, clunk and creak knocking. headlights mismatched and intermittent fail on both.

Burning smell from car after test drive.

Burning Smell north car after test unive.				
Road Conditions During Test Drive		Dry		
Engine Timing Mechanism		Cambelt		
Evidence of Can	n Belt Replacement	<b>✓</b> Yes	No	100,176 Kms
Inspected by:	Samuel Weir			
Published by:	Samuel Weir			
Inspection Date:	11 Nov 2025			

Engine Oil level Smoke & fumes	
Smoke & fumes	
Engine performance	
Engine performance  Noise  Coolant condition  Cooling performance	
Coolant condition	
Cooling performance	
Radiator / Hoses (visual)	
Transmission	
Operation 🗸	
Noise 🗸	
Clutch	<b>/</b>
CV joints 🗸	
Wheel bearings	
Brakes	
Performance 🗸	
Hand brake	
Tyres (lowest observed tread depth of tyres)	
Left front 1	mm
Right front 1.5	mm
	mm
Right rear 4	mm
Spare Yes	
Suspension	
Suspension performance 🗸	
Steering performance	
Shock absorbers 🗸	
Air Conditioning / Heater	
Operation 🗸	
Electrical / Accessories	
Head lights 🗸	
Tail lights 🗸	
Indicators 🗸	
Dashboard warning lights	
Wipers (front & rear)	
Window winder FL	
Window winder FR	
Window winder RL	
Window winder RR	
Rear view mirrors	
Radio (basic test only)	
CD (basic test only)	_
Number of keys 3	
Central locking	
Remote locking	
Sat. nav. (basic test only)	<u> </u>
Reversing camera	

I have read and understood this condition guide:

NAME