

Basic Condition Guide


•	Report ID:	27,177,481	Version:	2
	Created:	17 Nov 2025		

		ОК	Requires Attention	N/A
	Engine			
	Oil level	/		
	Smoke & fumes	/		
597	Engine performance	/		
	Noise	/		
or	Coolant condition	/		
mends a	Cooling performance	V		
	Radiator / Hoses (visual)	/		
nt scuffs	Transmission			
	Operation	V		
D SC	Noise	/		
DSC	Clutch			1
S	CV joints	/		
<u> </u>	Wheel bearings	1		
	Brakes		<u> </u>	
	Performance	V		
S	Hand brake	1		
	Tyres (lowest observed tread	depth of	tyres)	
	Left front	T.		5.0 mn
	Right front			5.5 mn
	Left rear			1.0 mn
SD	Right rear			3.0 mn
	Spare	Yes		
	Suspension			
	Suspension performance	V		
	Steering performance	1		
	Shock absorbers	1		
	Air Conditioning / Heater			
	Operation Operation	1	Ι	
	Electrical / Accessories			
	Head lights	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \		
	Tail lights Indicators			
		/		
	Dashboard warning lights	/		
	Wipers (front & rear)	V		
	Window winder FL	V		
	Window winder FR	/		
	Window winder RL	/		
	Window winder RR	/		
	Rear view mirrors	/		
	Radio (basic test only)		'	
	CD (basic test only)			
	Number of keys	2		
Kms	Central locking	/		
	Remote locking	/		
	Sat. nav. (basic test only)			/
	Reversing camera			1

Make:	Nissan	Model:	Dualis
Body Style:	Wagon	Year:	2007
Rego No.:	LCQ743	Rego Expiry:	28 Mar 2026
WoF Expiry:	28 Nov 2025	Odometer:	225,765 Kms
Good No.:	27177481	VIN:	7AT0DH7HX17072697
Next Service:	225,769KMs	Service History:	No
diagnostic testing ur	only. Consideration is mad	een driven up to 50km/l	arts have not been dismantled or n from cold. The Vendor recommends a or an additional charge.

Key

W = Signific S = ScratchR = RustC = Crack* = DecalsD = DentPT = Paint defect P = Pin dentSC = Stone Chips

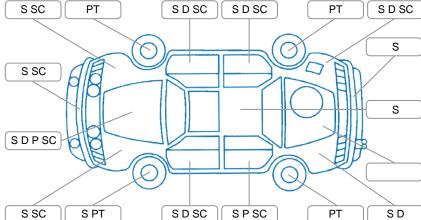

Note: some defects and blemishes may not be displayed in the diagram $\,$

Body Inspection Comments

Paint defect on side mirrors. Drivers door lock moulding missing. Tyre iron missing.

Stonechip in windscreen.

Drivers door check strap clicking.

Aerial missing.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments			
Seats:	Average, drivers seat base wearing.		
Carpets:	Good		
Panels:	Average		
Dashboard:	Average, steering wheel wearing. Dash vent broken.		

General Comments

Radio audio works intermittently.

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Troy Smith	
Published by:	Cody O'Neill	
Inspection Date:	10 Nov 2025	

have read and understood
his condition quide

NAME			

NATUR	F		