

# **Basic Condition Guide**

Report ID: 27,178,155 Version: 11 Nov 2025 Created:


Make:	Holden	Model:	Commodore
Body Style:	Sedan	Year:	2006
Rego No.:	DJK671	Rego Expiry:	05 Jan 2026
WoF Expiry:	03 Jan 2026	Odometer:	178,876 Kms
Good No.:	27178155	VIN:	6G1ZK54796L834082
Next Service:	192,000 kms	Service History:	No

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle ha been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

# Key

 $\mathsf{S} = \mathsf{Scratch}$ \* = DecalsW = Significant scuffs R = RustC = CrackSC = Stone Chips D = DentPT = Paint defect P = Pin dent

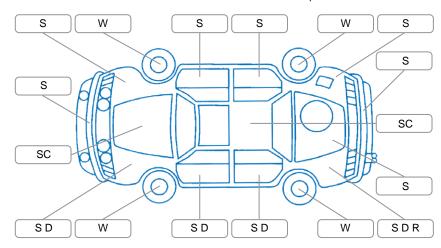

Note: some defects and blemishes may not be displayed in the diagram

## **Body Inspection Comments**

Headlights faded

RR door hinge creaking

Rear bumper moulding missing

Rear spoiler paint defect

Conditions During Body Inspection	Dry		
Under Carriage and Under Bonnet Inspection Comments			

Rwd Steering wheel worn

Windscreen stone chip cracked in CVA

Interior Comments			
Seats:	FR seat torn		
Carpets:	Average		
Panels:	RL door interior trim cracked		
Dashboard:	Average		

### **General Comments**

FR seat base trim broken

Bonnet gas lifting cylinder not working

RL tyre scalloped

FL windscreen sprayer not working

1 E Windooreen sprayer net working					
	Road Conditions During Test Drive		Dry		
Engine Timing Mechanism		Timing Chain			
	Evidence of Cam Belt Replacement		Yes	No k	(ms
	Inspected by: Vasanthakumar Mayilswamy				
	Published by:	Vasanthakumar Mayilswamy			
	Inspection Date: 11 Nov 2025				

	OK	Requires Attention	
Engine			
Oil level			V
Smoke & fumes	/		
Engine performance	<b>V</b>		
Noise	~		
Coolant condition	<b>/</b>		
Cooling performance	\( \tau \)		
Radiator / Hoses (visual)	<b>V</b>		
Transmission		<u> </u>	
Operation	<b>V</b>		
Noise	<b>/</b>		
Clutch			
CV joints	_		
Wheel bearings	<i>'</i>		
Brakes			
Performance	1	Ι	
Hand brake	<i>J</i>		
Tyres (lowest observed tread d	onth of	turos)	
Left front	ершог	tyles)	6 mm
Right front			4 mm
Left rear			
Right rear	Yes		3 mm
Spare	168		
Suspension			
Suspension performance	•		
Steering performance			
Shock absorbers			
Air Conditioning / Heater		l	
Operation	/		
Electrical / Accessories			
Head lights	-		
Tail lights	•		
Indicators	<b>V</b>		
Dashboard warning lights			
Wipers (front & rear)	<b>V</b>		
Window winder FL			
Window winder FR	<b>V</b>		
Window winder RL			
Window winder RR	/		
Rear view mirrors	<b>/</b>		
Radio (basic test only)	<b>/</b>		
CD (basic test only)	<b>/</b>		
Number of keys	2		
Central locking	/		
Remote locking	<b>/</b>		
Sat. nav. (basic test only)			<b>/</b>
Reversing camera			<b>V</b>

I have read and understood this condition guide:

NAME SIGNATURE