

Report ID:	27,563,907	Version:	2
Created:	04 Mar 2026		


Make:	Holden	Model:	Colorado
Body Style:	Utility	Year:	2014
Rego No.:	HST238	Rego Expiry:	22 Oct 2026
WoF Expiry:	14 Oct 2026	Odometer:	220,253 Kms
Good No.:	27563907	VIN:	MMU148FK0EH646390
Next Service:	Unknown	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

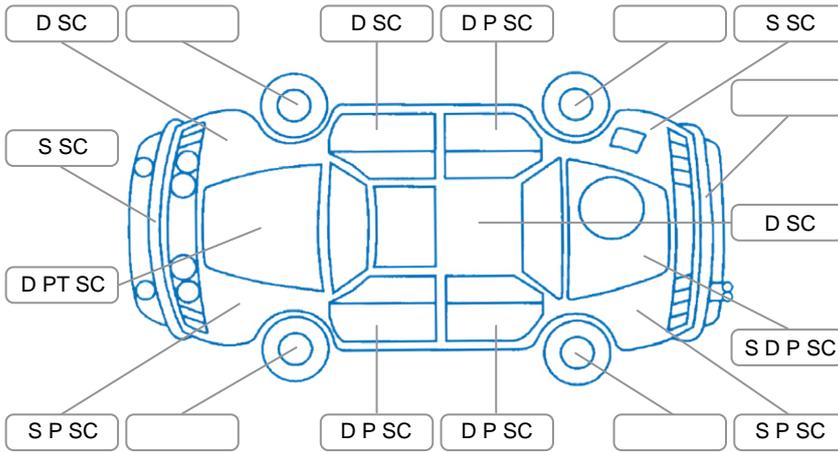

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Holes in front bumper fog light bezels.
 Additional aerial ports and holes in roof.
 Minor cracks in RH taillight.
 Paint defect on side mirrors.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Minor undercarriage surface rust.

Interior Comments

Seats:	Good
Carpets:	Good. Holes drilled in passenger footwell.
Panels:	Average, holes drilled in centre console.
Dashboard:	Average, metal plate in dash, steering wheel worn.

General Comments

Steering wheel audio controls not working.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms
Inspected by:	Troy Smith
Published by:	Carl Williams
Inspection Date:	04 Mar 2026

	OK	Requires Attention	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			4.0 mm
Left rear			4.5 mm
Right rear			2.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____