

Report ID:	27,564,169	Version:	2
Created:	22 Mar 2026		


Make:	Holden	Model:	Equinox
Body Style:	SUV	Year:	2020
Rego No.:	NEW789	Rego Expiry:	14 Dec 2026
WoF Expiry:	29 Nov 2026	Odometer:	287,975 Kms
Good No.:	27564169	VIN:	3G0AX7EX1LS694173
Next Service:	284,000 Kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

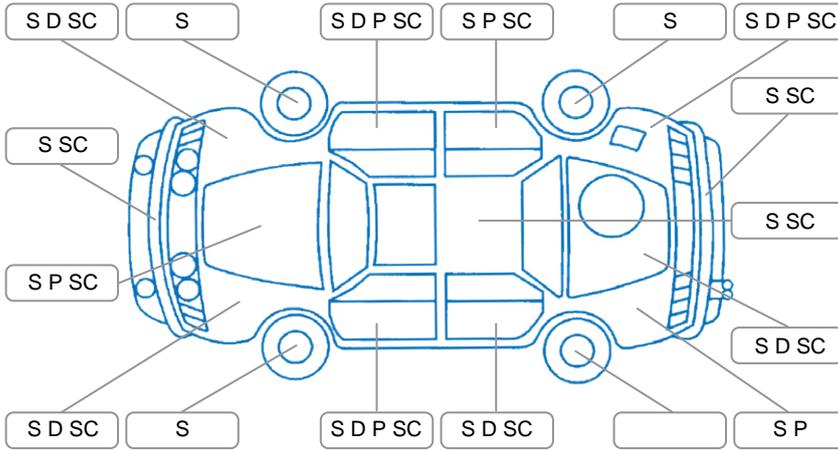

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Holes drilled in front and rear bumpers. Stonechips in windscreen.  
 4 additional aerial ports on roof. Custom boot deck board.  
 RH side mirror surround chipped.  
 RF door seal split.

Conditions During Body Inspection    Dry

**Under Carriage and Under Bonnet Inspection Comments**

**Interior Comments**

Seats:	Good
Carpets:	Poor, torn drivers side, holes in passenger side.
Panels:	Average, holes drilled, sunglasses holder missing.
Dashboard:	Poor, holes drilled, steering wheel worn.

**General Comments**

Fraying on drivers seatbelt.  
 Rear wiper blade needs replaced.  
 Cruise control steering wheel controls not working.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Troy Smith
Published by:	Troy Smith
Inspection Date:	22 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			3.5 mm
Right front			4.5 mm
Left rear			3.5 mm
Right rear			3.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)	✓		
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_