


Report ID:	27,564,861	Version:	2
Created:	30 Mar 2026		

Make:	Renault	Model:	Trafic
Body Style:	Van	Year:	2021
Rego No.:	NBY581	Rego Expiry:	18 Sep 2026
WoF Expiry:	19 Jan 2027	Odometer:	77,559 Kms
Good No.:	27564861	VIN:	VF1FL0006L0817364
Next Service:	78,000 kms	Service History:	No

**Note: This report is not a warranty**  
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**  
 S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

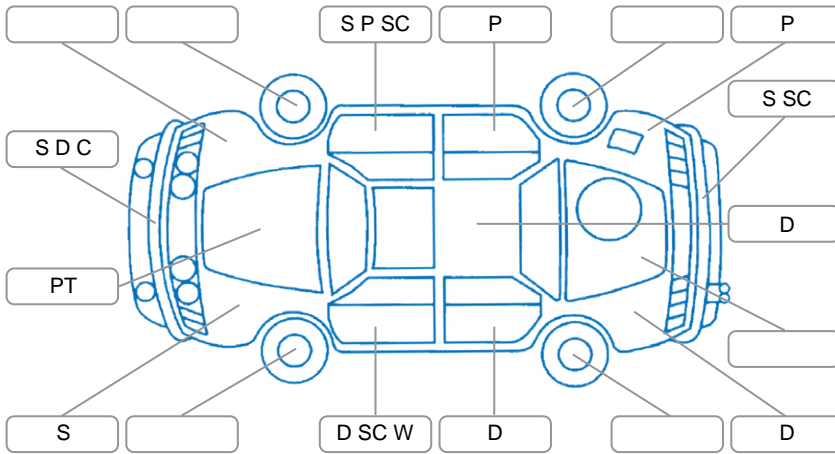

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Dents and scratches left B pillar, left wing mirror housing cracked  
 Left sill dents and gouge, left back door bent, right back door dents  
 Left front wheel centre cap missing, toolbox bolt missing, left tail light cracked  
 Scuffs cargo area inner frame and right wheel arch

Conditions During Body Inspection:  Wet  Dry

### Under Carriage and Under Bonnet Inspection Comments

Radiator dented, fan shroud cracked,  
 Front engine cover missing, rear engine cover cracked  
 Spare tyre worn on outer edge and puncture

### Interior Comments

Seats:	centre front seat adjustment handle broken
Carpets:	Good
Panels:	Average
Dashboard:	Good

### General Comments

Loud road noise from left rear tyre

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No      Kms
Inspected by:	Dean Sinclair
Published by:	Dean Sinclair
Inspection Date:	30 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			5.5 mm
Right front			6.0 mm
Left rear			8.0 mm
Right rear			4.5 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)	✓		
Reversing camera	✓		

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_